

## General Information

Date & Time: 16, Jan, 2026 15:49

<b>Make</b>	Nissan	<b>Model</b>	Livina
<b>YOM</b>	2023	<b>Odo Meter Reading</b>	35,758
<b>Registration No.</b>	LAL1440	<b>Chassis No.</b>	MK2LRND1WNN000596
<b>CC</b>	1.5	<b>Transmission</b>	A/T
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	SUV
<b>Colour</b>	Silver		

## Body / Panel Condition



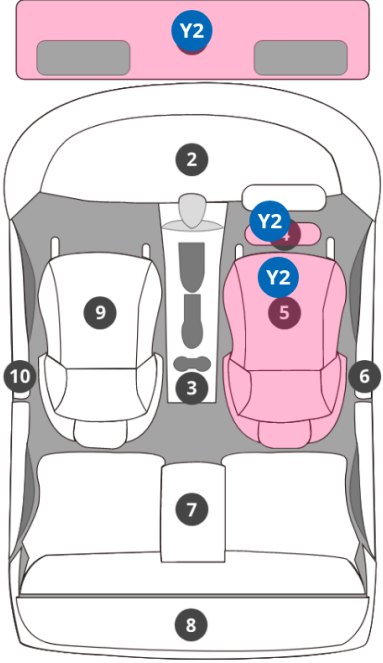
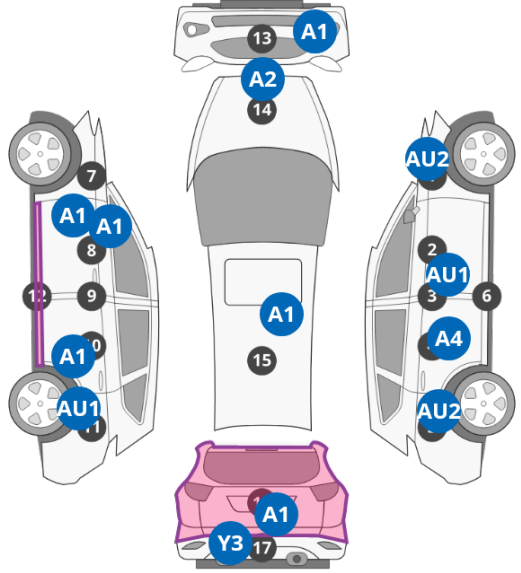
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	115.6	113	104	130
2	Boot Lid	145.3	111	198	127
3	Roof	107.3	122	99	106/102
4	Left Front Fender	97.3	102	95	95
5	Left Front Door	99.1	100	97	100
6	Center Panel Left				
7	Left Rear Door	111.0	119	108	106
8	Left Back Panel	110.0	101	106	123
9	Right Front Fender	88.4	93	87	86
10	Right Front Door	96.6	100	97	93
11	Center Panel Right				
12	Right Rear Door	95.2	98	92	96
13	Right Back Panel	108.4	122	104	99

**Overall Evaluation :**

**B**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (L) Front Floor Mat - Grime - Small / (R) Front Seat - Grime - Small / Ceiling - Grime - Small</p>	<p><b>Remarks</b> Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Front Fender, Molding - Scratch &amp; Dent - Small / (R) Front Door, Molding - Scratch &amp; Dent - Minimal / (R) Rear Door, Molding - Scratch - Large / (R) Rear Fender, Molding - Scratch &amp; Dent - Small / Rear Bumper, Lamps, Panels - Crack, Gap - Medium / Trunk Hood, Rear Gate - Repair mark - Difference in Color / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch &amp; Dent - Minimal / (L) Step, In-panel, Side Spoiler - Repair mark - Yes / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / Roof - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Minimal / Bonnet, Headlight - Scratch - Small</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Battery - Weak - Yes / Spare Key - Issue - Unexist</p>

**Inspector Notes**

With Lto plate, with spare tire and jack, 1key, no warranty booklet, no tools, scratches on headlights and taillights, battery weak,