

General Information

Date & Time: 19, Jan, 2026 16:27

Make	Toyota	Model	Avanza
YOM	2025	Odo Meter Reading	9,122
Registration No.	BAG6648	Chassis No.	MHFAA1BY6R0032648
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Wagon
Colour	Green		

Body / Panel Condition



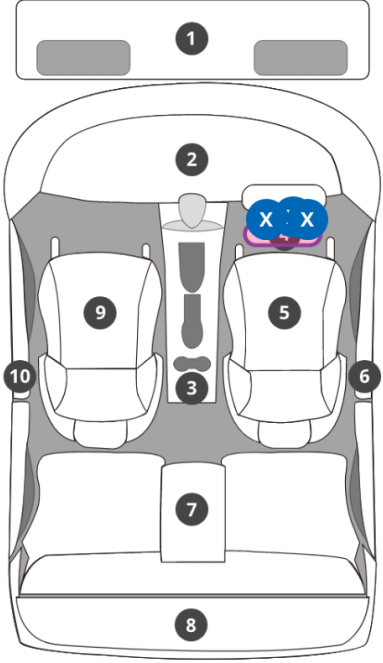
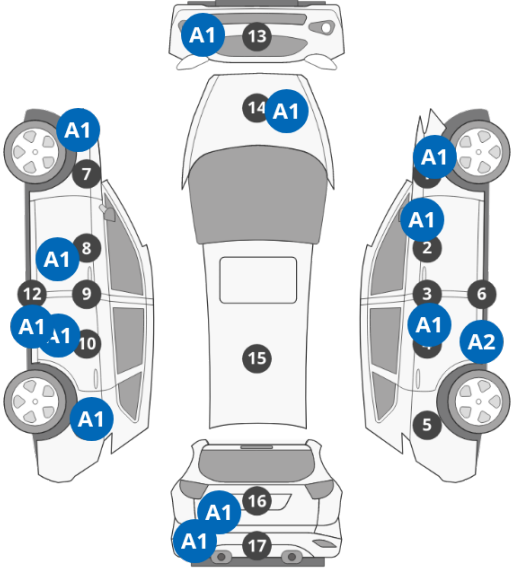
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	97.5	97	90	106
2	Boot Lid	74.9	77	75	74
3	Roof	120.0	133	122	119/106
4	Left Front Fender	80.7	95	71	77
5	Left Front Door	133.0	134	145	120
6	Center Panel Left				
7	Left Rear Door	115.6	123	114	110
8	Left Back Panel	185.0	175	211	169
9	Right Front Fender	85.2	86	88	82
10	Right Front Door	125.3	120	116	140
11	Center Panel Right				
12	Right Rear Door	113.6	115	110	116
13	Right Back Panel	154.3	159	157	147

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : B
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes</p>	<p>Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Door, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal</p>
Frame Evaluation : B	Functional Evaluation : A
<p>Remarks Front Cross Member Support - Condition of Welding ? - Yes</p>	<p>Remarks Defects not found</p>

<p>Inspector Notes</p>
<p>With Lto plate, with warranty booklet, with spare tire and jack, 2keys, no tools, scratches on headlights and taillights, cover under hood missing</p>