

## General Information

Date & Time: 20, Jan, 2026 08:33

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2024	<b>Odo Meter Reading</b>	38,321
<b>Registration No.</b>	DBM6098	<b>Chassis No.</b>	PA1B18F30R4245770
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Red		

## Body / Panel Condition



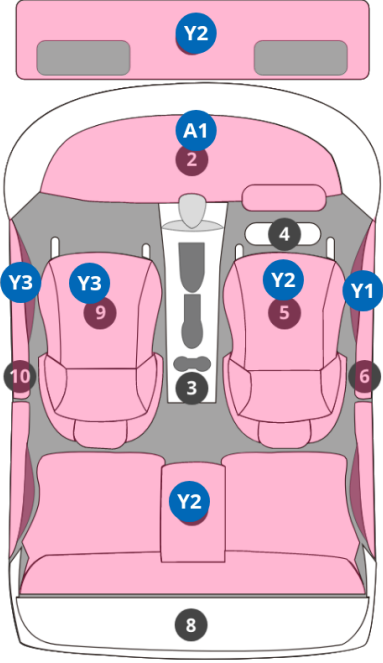
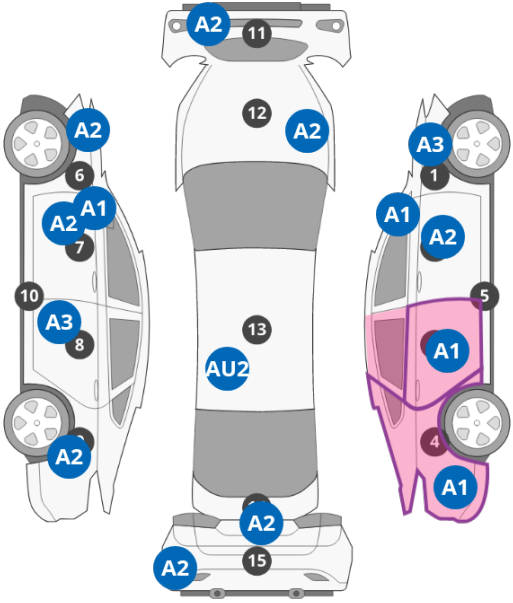
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	115.6	128	101	118
2	Boot Lid	100.3	99	95	108
3	Roof	109.2	117	99	113/108
4	Left Front Fender	97.4	100	94	99
5	Left Front Door	101.1	104	100	99
6	Center Panel Left				
7	Left Rear Door	106.3	117	103	99
8	Left Back Panel	109.6	120	107	102
9	Right Front Fender	103.0	107	102	100
10	Right Front Door	104.3	109	104	100
11	Center Panel Right				
12	Right Rear Door	172.6	163	207	148
13	Right Back Panel	189.0	176	173	218

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>B</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>D</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (R) Front Seat - Grime - Small / (R) Front Trim - Grime - Minimal / Rear Seat - Grime - Small / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Medium / Ceiling - Grime - Small / Dashboard - Worn, Scratch, Cut, Crack - Minimal</p>	<p><b>Remarks</b> (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (R) Rear Fender, Molding - Repair mark - Yes / (R) Rear Door, Molding - Repair mark - Yes / (R) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / Roof - Scratch &amp; Dent - Small / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / (R) Front Door, Molding - Scratch - Small</p>
<b>Frame Evaluation :</b> <span style="float: right;"><b>A</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>B</b></span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Battery - Weak - Yes</p>

<p><b>Inspector Notes</b></p>
<p>with LTO plate/with spare tire/with 1 spare key/with jack and incomplete tools/with reverse camera/No warranty booklets/No seat cover</p>