

## General Information

Date & Time: 21, Jan, 2026 12:17

<b>Make</b>	Toyota	<b>Model</b>	Hilux
<b>YOM</b>	2023	<b>Odo Meter Reading</b>	85,649
<b>Registration No.</b>	DBG9390	<b>Chassis No.</b>	MR0CB8CDXN0419213
<b>CC</b>	2.4	<b>Transmission</b>	M/T
<b>Fuel Type</b>	Diesel	<b>Type of Body</b>	Pickup
<b>Colour</b>	White		

## Body / Panel Condition



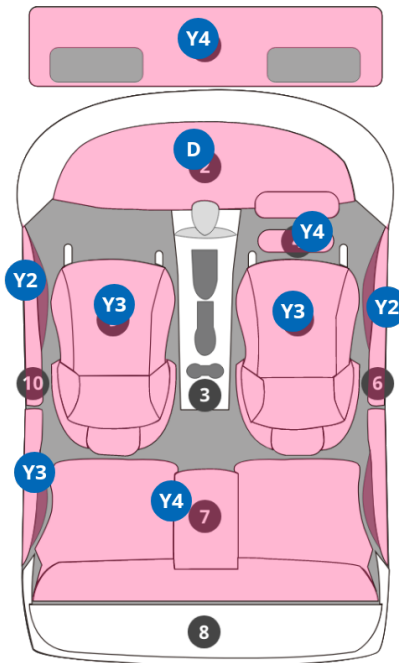
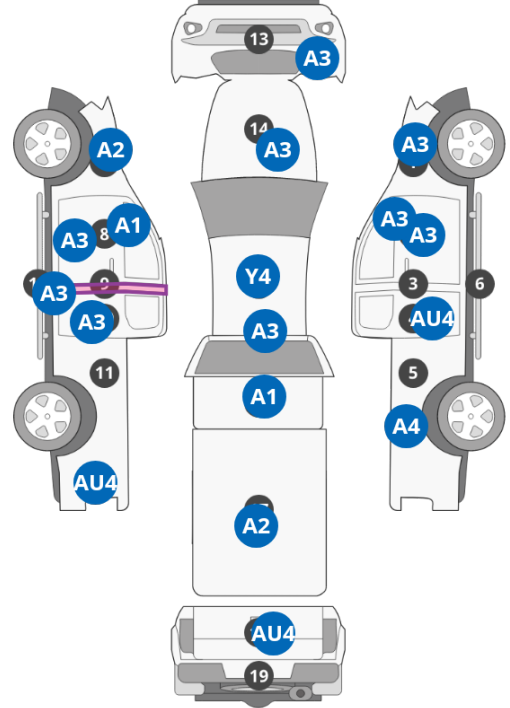
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	116.6	113	120	117
2	Boot Lid	93.2	103	86	90
3	Roof	94.0	90	91	102/94
4	Left Front Fender	90.2	87	90	94
5	Left Front Door	98.5	94	103	99
6	Center Panel Left	134.0	99	203	100
7	Left Rear Door	98.8	104	99	94
8	Left Back Panel	99.7	98	98	104
9	Right Front Fender	90.3	92	97	82
10	Right Front Door	91.1	90	93	91
11	Center Panel Right	79.7	121	57	61
12	Right Rear Door	97.8	98	97	99
13	Right Back Panel	101.3	108	94	102

## Overall Evaluation :

**D**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>D</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>E</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<b>Remarks</b> (R) Front Seat - Grime - Medium / (R) Front Trim - Grime - Small / (L) Front Seat - Grime - Medium / (L) Front Floor Mat - Grime - Large / (L) Front Trim - Grime - Small / (L) Rear Trim - Grime - Medium / Rear Seat - Grime - Large / Ceiling - Grime - Large / Dashboard - Traces of Adhesive Tape - Yes	<b>Remarks</b> (L) Center Panel - Repair Traces - Yes / Rear Gate - Scratch & Dent - Large / (L) Guard Frame - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Guard Frame - Scratch - Large / (R) Front Door, Molding - Scratch - Medium / (R) Front Fender, Molding - Scratch - Medium / (R) Mirror - Scratch - Medium / Bonnet, Headlight - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch - Medium / (L) Front Fender, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Scratch - Medium / (L) Rear Door, Molding - Scratch - Medium / Cab Back Panel - Scratch - Minimal / Roof - Scratch - Medium / Cargo Bed Floor - Scratch - Small / (L) Center Panel - Repair mark - Yes / Front Windshield - Damaged - Large
<b>Frame Evaluation :</b> <span style="float: right;"><b>A</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>B</b></span>
<b>Remarks</b> Defects not found	<b>Remarks</b> Battery - Weak - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

<b>Inspector Notes</b>
with LTO plate/No spare key/No spare tire/No reverse camera/with jack and incomplete tools/No seat cover/rear bumper partially parts missing/No fog light /left and right tail light medium crack/front windshield crack/possible flooding/interior dirty /unusual sound engine /plate light issue