

## General Information

Date & Time: 19, Jan, 2026 15:54

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2024	<b>Odo Meter Reading</b>	31,748
<b>Registration No.</b>	DBO7284	<b>Chassis No.</b>	PA1B18F32R4256401
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Red Mica Metallic		

## Body / Panel Condition



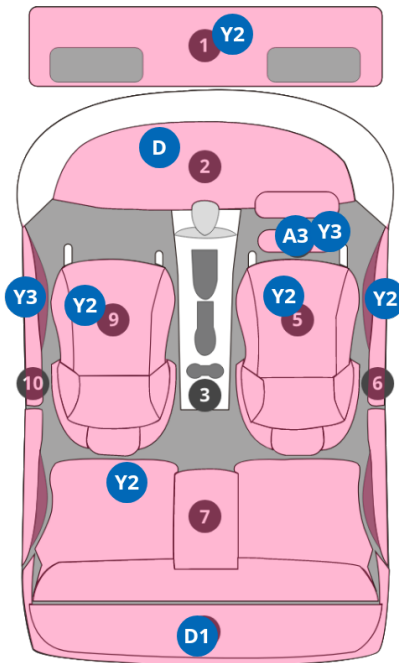
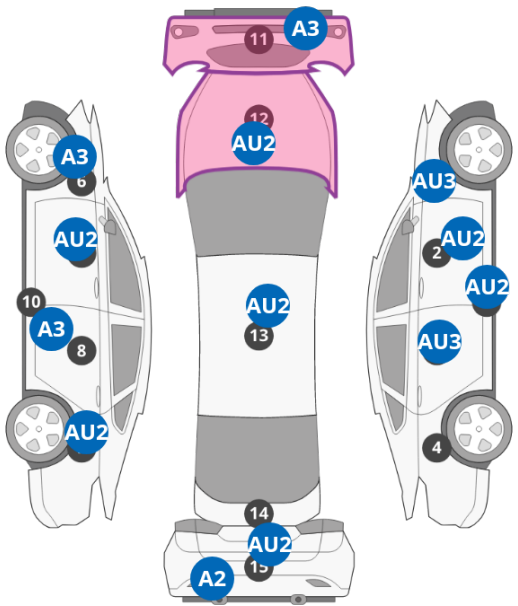
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	<b>187.3</b>	192	164	206
2	Boot Lid	<b>116.0</b>	114	110	124
3	Roof	<b>98.5</b>	102	101	92/100
4	Left Front Fender	<b>103.6</b>	103	99	109
5	Left Front Door	<b>103.6</b>	102	102	107
6	Center Panel Left				
7	Left Rear Door	<b>102.4</b>	103	105	99
8	Left Back Panel	<b>108.3</b>	109	102	114
9	Right Front Fender	<b>101.3</b>	109	100	96
10	Right Front Door	<b>101.8</b>	102	100	104
11	Center Panel Right				
12	Right Rear Door	<b>104.6</b>	104	104	106
13	Right Back Panel	<b>107.3</b>	101	109	112

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Dashboard - Traces of Adhesive Tape - Yes / (L) Front Trim - Grime - Medium / (R) Front Trim - Grime - Small / (L) Front Floor Mat - Cut, Crack - Medium / (R) Front Floor Mat - Grime - Medium / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / Rear Seat - Grime - Small / Ceiling - Grime - Small / Trunk Room - Worked - Minimal</p>	<p><b>Remarks</b> Bonnet - Repair Traces - Yes / Roof - Scratch &amp; Dent - Small / (R) Rear Door, Molding - Scratch &amp; Dent - Medium / (R) Front Door, Molding - Scratch &amp; Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Small / (R) Front Fender, Molding - Scratch &amp; Dent - Medium / Front Bumper, Grille, Lamps - Scratch - Medium / Front Bumper, Grille, Lamps - Repair mark - Yes / Bonnet, Headlight - Repair mark - Yes / Bonnet, Headlight - Scratch &amp; Dent - Small / (L) Front Fender, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch &amp; Dent - Small / (L) Rear Door, Molding - Scratch - Medium / (L) Rear Fender, Molding - Scratch &amp; Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch &amp; Dent - Small</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Battery - Weak - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>with LTO plate, with spare tire, with reverse camera, no tools and jack, with manual booklet, scratches on taillight and headlight</p>