

General Information

Date & Time: 19, Jan, 2026 15:00

Make	Toyota	Model	Avanza
YOM	2024	Odo Meter Reading	21,175
Registration No.	GBA4825	Chassis No.	MHFAA1BY2P0018458
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	MPV
Colour	Green		

Body / Panel Condition



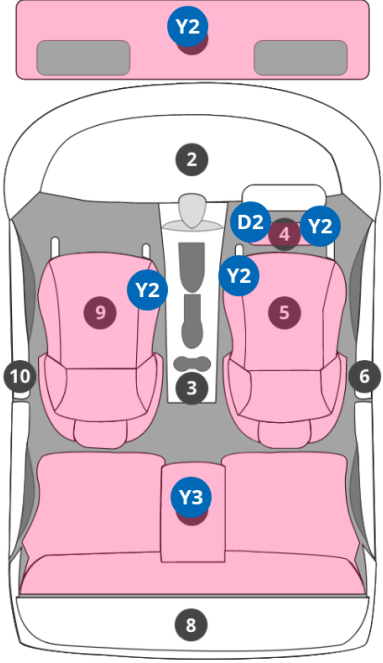
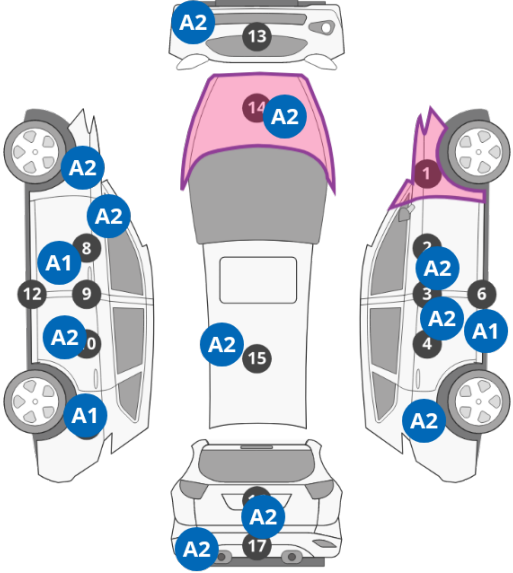
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	218.0	222	223	209
2	Boot Lid	116.3	120	121	108
3	Roof	121.2	130	132	107/116
4	Left Front Fender	105.6	105	105	107
5	Left Front Door	121.6	110	124	131
6	Center Panel Left				
7	Left Rear Door	115.0	122	111	112
8	Left Back Panel	119.3	133	117	108
9	Right Front Fender	231.3	234	230	230
10	Right Front Door	168.6	173	163	170
11	Center Panel Right				
12	Right Rear Door	121.6	122	118	125
13	Right Back Panel	113.6	111	111	119

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Floor Mat - Grime - Small / (R) Front Seat - Grime - Small / Ceiling - Grime - Small / Rear Seat - Grime - Medium / (L) Front Seat - Grime - Small / (L) Front Floor Mat - Worked - Small</p>	<p>Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / Bonnet, Headlight - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / (L) Front Fender, Molding - Scratch - Small / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / Roof - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Minimal</p>
Frame Evaluation : C	Functional Evaluation : A
<p>Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes / Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>Bonnet and front right fender panel repainted and possible repaired. With warranty booklet, spare tire and jack. Without tools and seat cover. 1 key. With LTO plate.</p>