

General Information

Date & Time: 17, Jan, 2026 11:17

Make	Toyota	Model	Fortuner
YOM	2018	Odo Meter Reading	49,559
Registration No.	NDA1521	Chassis No.	MHFHA3FSXJ0566845
CC	2.8	Transmission	A/T
Fuel Type	Diesel	Type of Body	SUV
Colour	White		

Body / Panel Condition



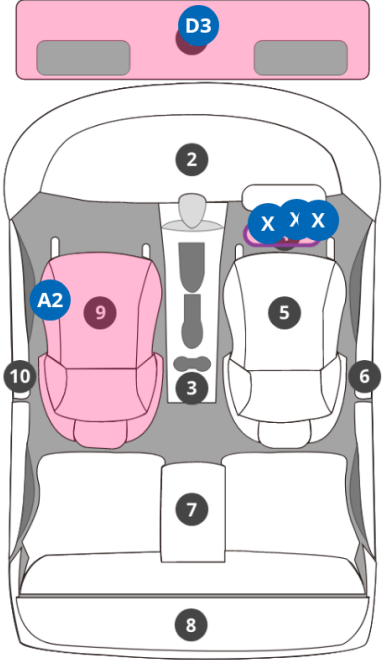
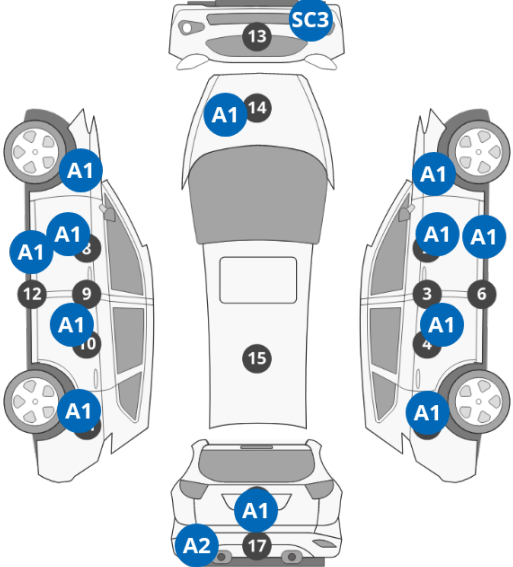
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	131.6	124	140	131
2	Boot Lid	184.6	172	214	168
3	Roof	124.7	146	131	112/110
4	Left Front Fender	184.0	195	179	178
5	Left Front Door	172.6	168	169	181
6	Center Panel Left				
7	Left Rear Door	181.3	222	156	166
8	Left Back Panel	200.0	210	183	207
9	Right Front Fender	193.3	202	182	196
10	Right Front Door	160.6	176	146	160
11	Center Panel Right				
12	Right Rear Door	154.3	150	135	178
13	Right Back Panel	129.3	142	114	132

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : B
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / Sunvisor, Sunglass Holder - Loose, Deformed - Medium / (L) Front Seat - Fray - Small	Remarks (R) Front Fender - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Overall Exterior - Full Re-Paint in same color - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Rust, Corrosion - Medium / Bonnet, Headlight - Scratch - Minimal
Frame Evaluation : B	Functional Evaluation : A
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Defects not found

Inspector Notes
With Lto plate, with warranty booklet, with spare tire and jack, 2keys, no tools, scratches on headlights and taillights, room light issue