

General Information

Date & Time: 17, Jan, 2026 11:19

Make	Mitsubishi	Model	Xpander
YOM	2019	Odo Meter Reading	81,261
Registration No.	NBP1331	Chassis No.	MK2XRNC1WKN002321
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	Utility Vehicle
Colour	Black		

Body / Panel Condition



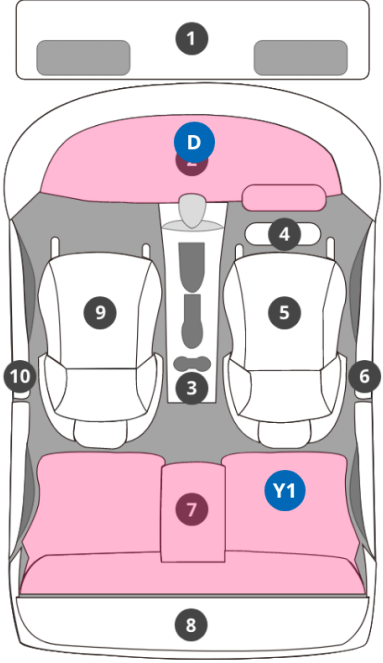
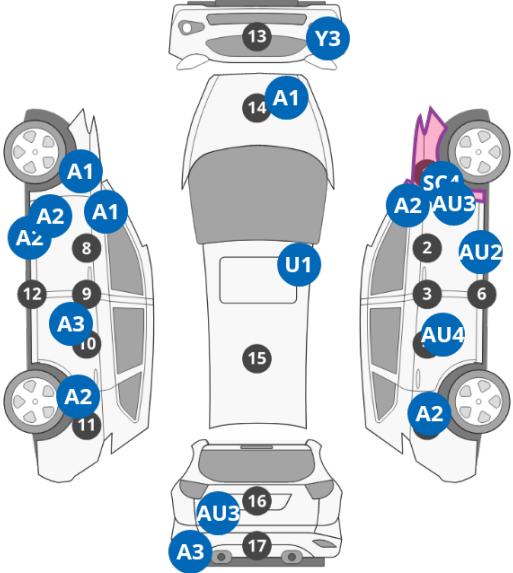
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	102.4	103	98	106
2	Boot Lid	119.6	122	110	127
3	Roof	103.0	113	97	103/99
4	Left Front Fender	97.1	103	99	90
5	Left Front Door	91.2	104	70	100
6	Center Panel Left				
7	Left Rear Door	89.5	93	73	102
8	Left Back Panel	136.0	133	139	136
9	Right Front Fender	121.6	123	123	119
10	Right Front Door	129.6	130	125	134
11	Center Panel Right				
12	Right Rear Door	102.3	100	100	107
13	Right Back Panel	127.6	142	118	123

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Dashboard - Traces of Adhesive Tape - Yes / Rear Seat - Grime - Minimal</p>	<p>Remarks (R) Front Fender - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (R) Front Fender, Molding - Repair mark - Yes / (R) Front Fender, Molding - Rust, Corrosion - Large / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Crack, Gap - Medium / Roof - Dent - Minimal / Bonnet, Headlight - Scratch - Minimal</p>
Frame Evaluation : B	Functional Evaluation : B
<p>Remarks Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Retractable Mirror - Issue - Yes</p>

<p>Inspector Notes</p>
<p>With Lto plate, with spare tire andjack, 2keys, no warranty booklet, no tools, scratches on headlights and taillights</p>