

General Information

Date & Time: 17, Jan, 2026 14:08

Make	Toyota	Model	Raize
YOM	2024	Odo Meter Reading	10,666
Registration No.	NIR2360	Chassis No.	MHKAB1BA4PJ062425
CC	1.2	Transmission	M/T
Fuel Type	Gas	Type of Body	SUV
Colour	Gray		

Body / Panel Condition



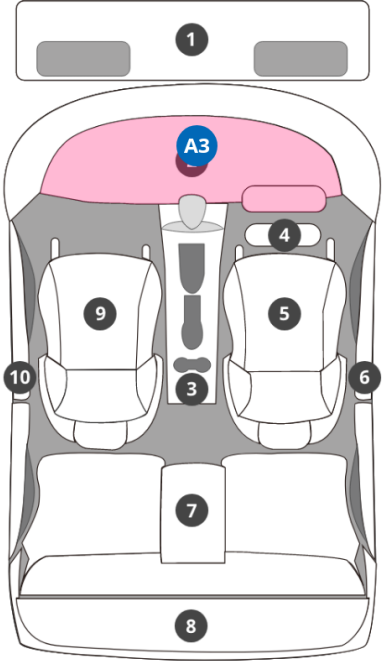
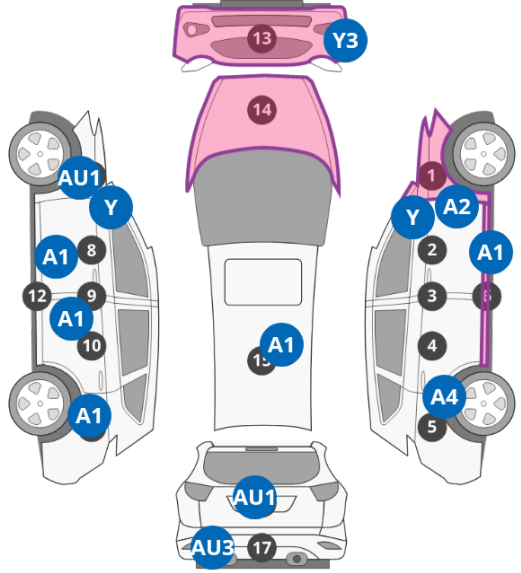
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	244.6	246	208	280
2	Boot Lid	86.7	78	99	82
3	Roof	91.3	101	94	83/88
4	Left Front Fender	353.6	235	595	231
5	Left Front Door	140.0	156	139	125
6	Center Panel Left				
7	Left Rear Door	91.9	101	89	86
8	Left Back Panel	85.3	88	76	93
9	Right Front Fender	706.0	478	478	1,162
10	Right Front Door	133.0	110	138	151
11	Center Panel Right				
12	Right Rear Door	128.7	210	92	85
13	Right Back Panel	231.6	110	365	220

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks Dashboard - Worn, Scratch, Cut, Crack - Medium	Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Overall Exterior - Full Re-Paint in same color - Yes / (R) Front Fender, Molding - Repair mark - Yes / (R) Front Fender, Molding - Partially Missing - Yes / (R) Mirror - Crack - Cracks / (R) Front Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Repair mark - Difference in Color / (R) Rear Fender, Molding - Scratch - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Crack - Cracks / (L) Front Fender, Molding - Scratch & Dent - Minimal / Front Bumper, Grille, Lamps - Repair mark - Yes / Roof - Scratch - Minimal / Bonnet, Headlight - Repair mark - Yes / Front Bumper, Grille, Lamps - Crack, Gap - Medium
Frame Evaluation : C	Functional Evaluation : C
Remarks Front Cross Member Support - Condition of Welding ? - Yes / Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Panel, Meter - Issue - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
With Lto plate, with spare tire, 1key, no warranty booklet, no jack and tools, scratches on headlights and taillights, unusual sound on engine, abnormal vibration on vehicle, engine oil leak