

## General Information

Date & Time: 19, Jan, 2026 16:39

<b>Make</b>	Honda	<b>Model</b>	Brio
<b>YOM</b>	2019	<b>Odo Meter Reading</b>	60,895
<b>Registration No.</b>	NDM2053	<b>Chassis No.</b>	MHRDD1870KJ000522
<b>CC</b>	1.2	<b>Transmission</b>	A/T
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Hatchback
<b>Colour</b>	White		

## Body / Panel Condition



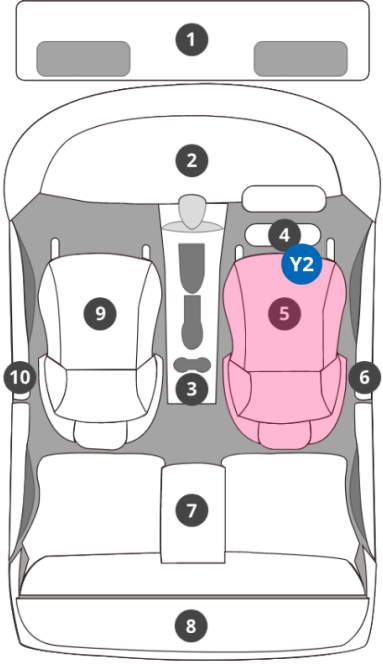
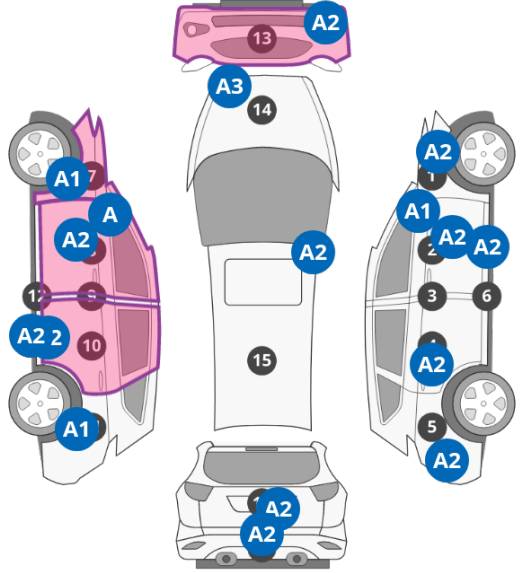
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	76.7	80	74	76
2	Boot Lid	120.0	97	163	100
3	Roof	102.8	99	92	109/112
4	Left Front Fender	673.0	753	954	312
5	Left Front Door	424.0	207	194	871
6	Center Panel Left				
7	Left Rear Door	121.3	154	115	95
8	Left Back Panel	109.0	109	113	105
9	Right Front Fender	117.0	115	114	122
10	Right Front Door	121.0	107	108	148
11	Center Panel Right				
12	Right Rear Door	113.0	101	118	120
13	Right Back Panel	108.0	108	109	107

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<b>Remarks</b> (R) Front Seat - Grime - Small	<b>Remarks</b> (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Door, Molding - Repair mark - Difference in Color / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Repair mark - Difference in Color / (L) Mirror - Scratch, Peeled - Yes / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Front Fender, Molding - Repair mark - Difference in Color / Front Bumper, Grille, Lamps - Repair mark - Difference in Color / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch - Small / Roof - Scratch - Small
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>
<b>Remarks</b> Front Cross Member Support - Condition of Welding ? - Yes	<b>Remarks</b> Head Light, High Beam - Issue - Yes / Horn - Issue - Yes

<b>Inspector Notes</b>
With Lto plate, with warranty booklet, with spare tire and jack, 1key, no tools, scratches on headlights and taillights, stain on vehicle