

## General Information

Date & Time: 17, Jan, 2026 15:56

<b>Make</b>	Hyundai	<b>Model</b>	Accent
<b>YOM</b>	2018	<b>Odo Meter Reading</b>	68,531
<b>Registration No.</b>	DAD3594	<b>Chassis No.</b>	KMHCT41BAJU419862
<b>CC</b>	1.4	<b>Transmission</b>	M/T
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Black		

## Body / Panel Condition



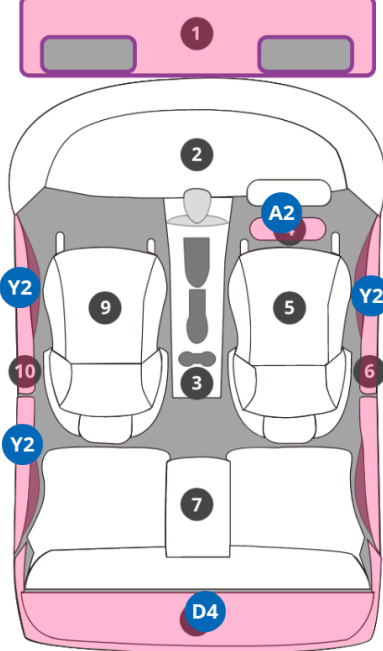
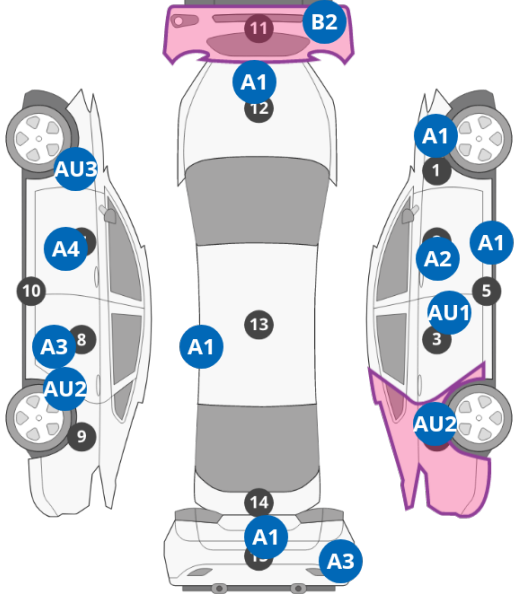
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	110.3	112	118	101
2	Boot Lid	197.6	225	182	186
3	Roof	97.4	96	115	84/95
4	Left Front Fender	152.3	147	142	168
5	Left Front Door	435.0	157	468	680
6	Center Panel Left				
7	Left Rear Door	105.8	115	109	93
8	Left Back Panel	138.3	142	128	145
9	Right Front Fender	101.3	100	101	103
10	Right Front Door	112.0	122	112	102
11	Center Panel Right				
12	Right Rear Door	103.6	94	111	106
13	Right Back Panel	115.0	126	106	113

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">D</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Room Lamp - Missing - Yes / (L) Front Floor Mat - Cut, Crack - Small / (R) Front Trim - Grime - Small / Trunk Room - Loose, Deformed - Large / (L) Rear Trim - Grime - Small / (L) Front Trim - Grime - Small</p>	<p><b>Remarks</b> (L) Front Door - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Rear Door, Molding - Scratch &amp; Dent - Minimal / (R) Rear Fender, Molding - Scratch &amp; Dent - Small / (R) Rear Fender, Molding - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch &amp; Dent - Small / (L) Rear Door, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Large / (L) Front Fender, Molding - Scratch &amp; Dent - Medium / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Modified - Small / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Minimal</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>With Lto plate, 1key, with spare tire, no warranty booklet, no jack and tools, scratches on headlights and taillights, trunk cover missing, cover under hood missing</p>