

## General Information

Date & Time: 21, Jan, 2026 14:01

<b>Make</b>	Suzuki	<b>Model</b>	Swift
<b>YOM</b>	2021	<b>Odo Meter Reading</b>	59,910
<b>Registration No.</b>	FAF6895	<b>Chassis No.</b>	MMSZC63S2MR101275
<b>CC</b>	1.2	<b>Transmission</b>	A/T
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Hatchback
<b>Colour</b>	Red		

## Body / Panel Condition



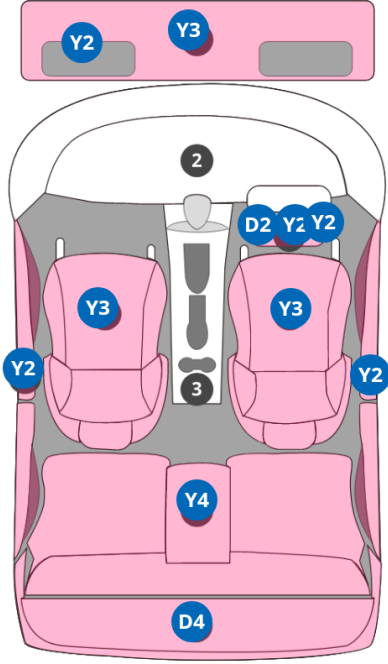
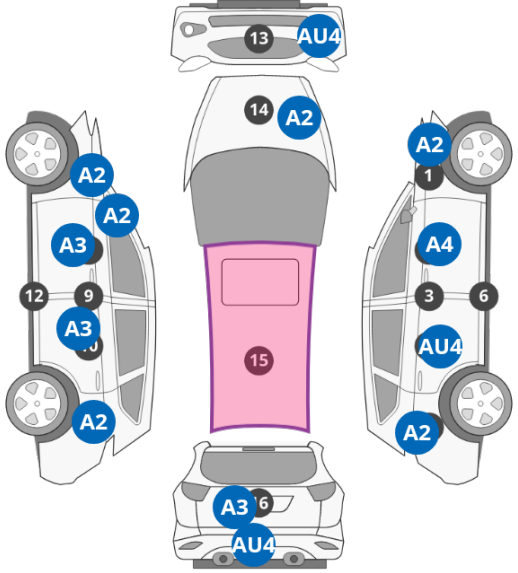
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	102.0	92	110	104
2	Boot Lid	111.0	106	112	115
3	Roof	175.7	202	100	207/194
4	Left Front Fender	105.0	100	103	112
5	Left Front Door	112.6	120	112	106
6	Center Panel Left				
7	Left Rear Door	106.5	119	101	100
8	Left Back Panel	180.3	132	131	278
9	Right Front Fender	102.2	122	91	94
10	Right Front Door	150.3	140	155	156
11	Center Panel Right				
12	Right Rear Door	104.1	97	101	114
13	Right Back Panel	113.6	117	108	116

## Overall Evaluation :

**D**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">D</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (L) Front Trim - Grime - Small / (L) Front Floor Mat - Worked - Small / (L) Front Seat - Grime - Medium / Mat Other - Grime - Small / Rear Seat - Grime - Large / Trunk Room - Loose, Deformed - Large / (R) Front Trim - Grime - Small / (R) Front Seat - Grime - Medium / (R) Front Floor Mat - Grime - Small / Ceiling - Grime - Medium / Sunvisor, Sunglass Holder - Grime - Small</p>	<p><b>Remarks</b> (L) Rear Fender - Repair Traces - Yes / Roof - Repair Traces - Yes / Roof - Repair mark - Difference in Color / (L) Front Fender, Molding - Scratch - Small / (L) Mirror - Scratch - Small / (L) Rear Door, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Large / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch &amp; Dent - Large / (R) Front Door, Molding - Scratch - Large / (R) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch &amp; Dent - Large / Bonnet, Headlight - Scratch - Small</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>Roof was wrapped in black color. Left reverse light not working. Rearleft window switch issue. Sunvisor mirror cover issue both side. Without warranty booklet, spare tire, tools and seat cover. With jack. 1 key. With LTO plate. With dashcam.</p>