

## General Information

Date & Time: 20, Jan, 2026 16:35

<b>Make</b>	Toyota	<b>Model</b>	Avanza
<b>YOM</b>	2024	<b>Odo Meter Reading</b>	14,552
<b>Registration No.</b>	GBC9543	<b>Chassis No.</b>	MHFAA1BY1P0021643
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	MPV
<b>Colour</b>	Green		

## Body / Panel Condition



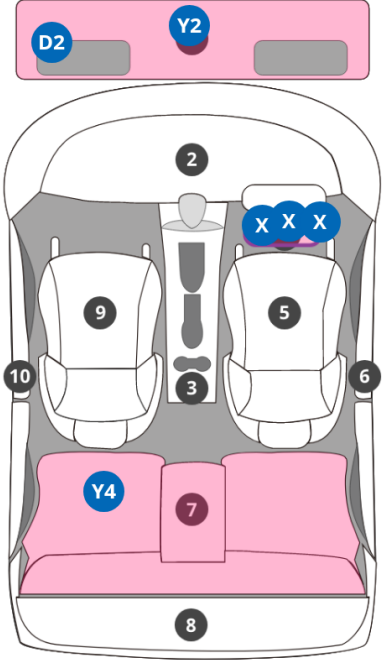
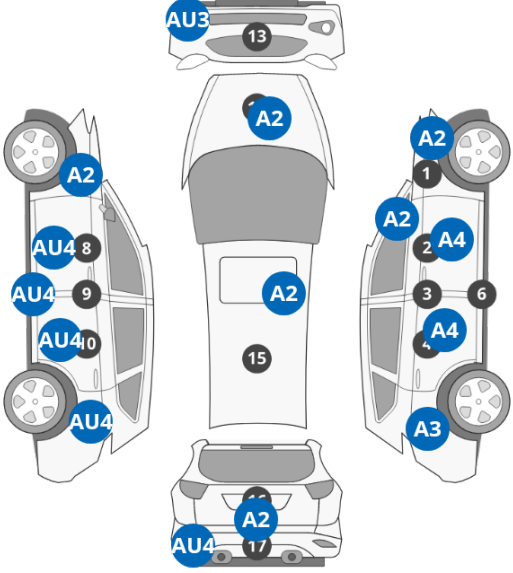
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	109.6	108	111	110
2	Boot Lid	109.3	109	117	102
3	Roof	121.7	125	132	110/120
4	Left Front Fender	98.9	98	99	100
5	Left Front Door	123.0	114	123	132
6	Center Panel Left				
7	Left Rear Door	117.6	124	114	115
8	Left Back Panel	116.3	117	118	114
9	Right Front Fender	104.0	111	101	100
10	Right Front Door	197.3	217	189	186
11	Center Panel Right				
12	Right Rear Door	113.6	115	105	121
13	Right Back Panel	114.6	106	110	128

## Overall Evaluation :

**D**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (L) Front Floor Mat - Missing - Yes / Sunvisor, Sunglass Holder - Crinkle - Small / Ceiling - Grime - Small / Mat Other - Missing - Yes / Rear Seat - Grime - Large / (R) Front Floor Mat - Missing - Yes</p>	<p><b>Remarks</b> (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / Bonnet, Headlight - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch &amp; Dent - Large / (L) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Large / (L) Rear Door, Molding - Scratch &amp; Dent - Large / (L) Rear Fender, Molding - Scratch &amp; Dent - Large / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Large / (R) Rear Fender, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Large / (R) Front Door, Molding - Scratch - Large / (R) Mirror - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch &amp; Dent - Medium / Roof - Scratch - Small</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">D</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>
<p><b>Remarks</b> Left Tyre House - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Center Pillar - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Pillar - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p><b>Remarks</b> Defects not found</p>

**Inspector Notes**

With warranty booklet, spare tire, jack and seat cover. Without tools. 2 keys. With LTO plate.