

## General Information

Date & Time: 20, Jan, 2026 14:52

<b>Make</b>	Toyota	<b>Model</b>	Hilux
<b>YOM</b>	2021	<b>Odo Meter Reading</b>	65,741
<b>Registration No.</b>	NEW4113	<b>Chassis No.</b>	MR0JB8DD2M3181618
<b>CC</b>	2.4	<b>Transmission</b>	A/T
<b>Fuel Type</b>	Diesel	<b>Type of Body</b>	Pickup
<b>Colour</b>	White		

## Body / Panel Condition



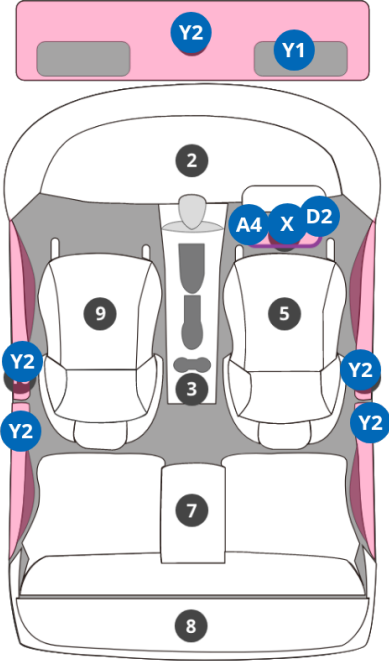
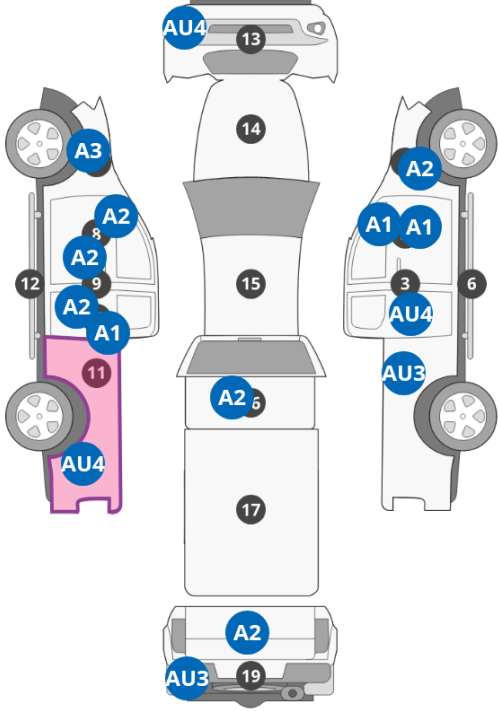
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	<b>116.0</b>	114	123	111
2	Boot Lid	<b>92.6</b>	95	85	98
3	Roof	<b>105.7</b>	102	95	121/105
4	Left Front Fender	<b>108.9</b>	110	99	118
5	Left Front Door	<b>114.6</b>	113	120	111
6	Center Panel Left				
7	Left Rear Door	<b>110.3</b>	113	108	110
8	Left Back Panel	<b>113.3</b>	106	111	123
9	Right Front Fender	<b>104.0</b>	106	100	106
10	Right Front Door	<b>102.0</b>	104	104	98
11	Center Panel Right				
12	Right Rear Door	<b>105.3</b>	104	101	111
13	Right Back Panel	<b>114.0</b>	121	106	115

## Overall Evaluation :

**D**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b>	C	<b>Exterior Evaluation :</b>	E
			
<p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>		<p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>	
<p><b>Remarks</b> (R) Front Trim - Grime - Small / Sunvisor, Sunglass Holder - Grime - Minimal / Ceiling - Grime - Small / Mat Other - Missing - Yes / (R) Rear Trim - Grime - Small / (L) Rear Trim - Grime - Small / (L) Front Floor Mat - Cut, Crack - Large / (L) Front Trim - Grime - Small / (R) Front Floor Mat - Worked - Small</p>		<p><b>Remarks</b> (R) Rear Door, Molding - Scratch &amp; Dent - Large / (R) Front Door, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch &amp; Dent - Large / (L) Front Fender, Molding - Scratch - Medium / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Rear Corner Panel - Scratch - Minimal / (L) Side Gate - Scratch &amp; Dent - Large / Rear Gate - Scratch - Small / (R) Side Gate - Scratch &amp; Dent - Medium / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Medium / Cab Back Panel - Scratch - Small / (L) Rear Wheel, Cover - Cap Missing - Yes</p>	
<b>Frame Evaluation :</b>	A	<b>Functional Evaluation :</b>	E
<p><b>Remarks</b> Defects not found</p>		<p><b>Remarks</b> Shift Shock - Function - Weak / Air Conditioner - Function - Weak / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>	

## Inspector Notes

Possible flooding. Aircon issue. Shift knob loose. Park light not working. With warranty booklet, spare tire, and leather seat cover. Without jack and tools. 1 key. With LTO plate.