

General Information

Date & Time: 21, Jan, 2026 15:22

| | | | |
|-------------------------|---------|--------------------------|-------------------|
| Make | Hyundai | Model | Accent |
| YOM | 2019 | Odo Meter Reading | 83,083 |
| Registration No. | FAH1890 | Chassis No. | KMHCT41BAKU457721 |
| CC | 1.4 | Transmission | M/T |
| Fuel Type | Gas | Type of Body | Sedan |
| Colour | Blue | | |

Body / Panel Condition



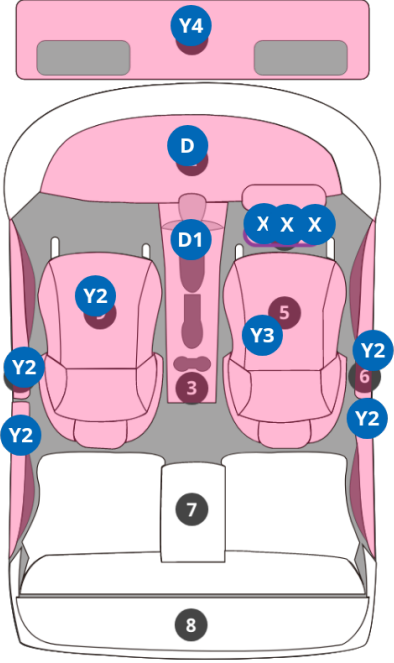
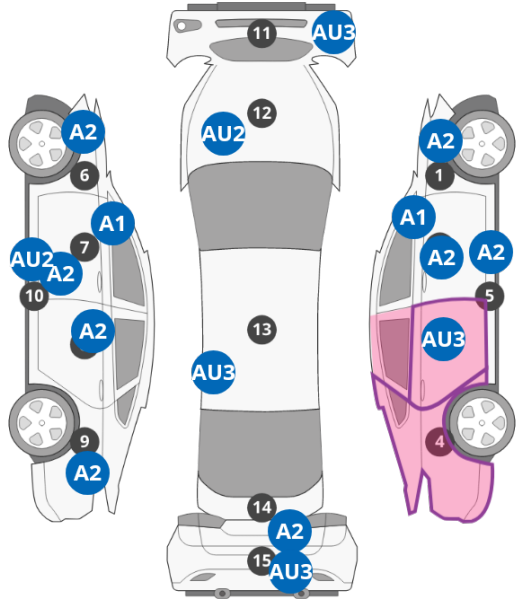
| # | Area | Thickness(um) | | | |
|----|--------------------|---------------|--------|--------|----------|
| | | Average | Value1 | Value2 | Value3/4 |
| 1 | Bonnet | 120.6 | 120 | 128 | 114 |
| 2 | Boot Lid | 113.0 | 115 | 115 | 109 |
| 3 | Roof | 98.9 | 108 | 111 | 86/91 |
| 4 | Left Front Fender | 127.0 | 117 | 129 | 135 |
| 5 | Left Front Door | 118.3 | 115 | 118 | 122 |
| 6 | Center Panel Left | | | | |
| 7 | Left Rear Door | 113.0 | 121 | 114 | 104 |
| 8 | Left Back Panel | 127.3 | 114 | 126 | 142 |
| 9 | Right Front Fender | 91.6 | 95 | 95 | 85 |
| 10 | Right Front Door | 191.6 | 216 | 201 | 158 |
| 11 | Center Panel Right | | | | |
| 12 | Right Rear Door | 240.0 | 159 | 200 | 361 |
| 13 | Right Back Panel | 180.3 | 169 | 193 | 179 |

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

| | |
|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Interior Evaluation : C | Exterior Evaluation : E |
|  <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p> |  <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p> |
| <p>Remarks (L) Front Floor Mat - Missing - Yes / (R) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / (L) Front Trim - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes / (L) Front Seat - Grime - Small / (L) Rear Trim - Grime - Small / Ceiling - Grime - Large / (R) Rear Trim - Grime - Small / (R) Front Trim - Grime - Small / (R) Front Seat - Grime - Medium / Console, Switches, Vents - Worked - Minimal</p> | <p>Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Bonnet, Headlight - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Rear Fender, Molding - Repair mark - Yes / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Repair mark - Yes / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (L) Rear Fender, Molding - Scratch - Small / Roof - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Medium</p> |
| Frame Evaluation : B | Functional Evaluation : B |
| <p>Remarks Right Tyre House - Traces of Bending, or Marks of Panel Repair ? - Yes</p> | <p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Horn - Issue - Yes / Spare Key - Issue - Unexist</p> |

| |
|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <p>Inspector Notes</p> |
| <p>Unusual sound when opening of left front door. Watermarks on taillight. Scratches on taillight and headlight. Grime at trunk floor. Without warranty booklet, jack, tools and seat cover. With spare tire. 1 key. With LTO plate.</p> |