

General Information

Date & Time: 20, Jan, 2026 13:58

Make	Toyota	Model	Wigo
YOM	2025	Odo Meter Reading	22,992
Registration No.	HAG8752	Chassis No.	MHKAA1BC4RJ026029
CC	1.0	Transmission	CVT
Fuel Type	Gas	Type of Body	Hatchback
Colour	Red Mica Metallic		

Body / Panel Condition



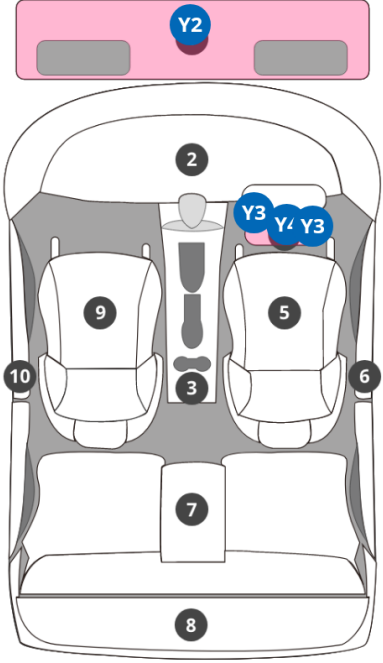
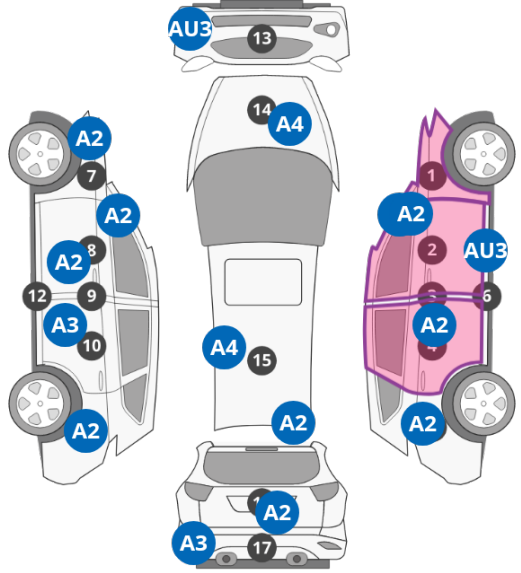
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	118.3	120	120	115
2	Boot Lid	86.2	85	87	87
3	Roof	84.5	81	80	87/91
4	Left Front Fender	93.7	90	103	88
5	Left Front Door	110.3	109	112	110
6	Center Panel Left				
7	Left Rear Door	99.5	105	100	94
8	Left Back Panel	139.6	137	122	160
9	Right Front Fender	158.0	153	173	148
10	Right Front Door	196.0	206	197	185
11	Center Panel Right				
12	Right Rear Door	176.3	170	161	198
13	Right Back Panel	156.6	153	149	168

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Floor Mat - Grime - Medium / Ceiling - Grime - Small / Mat Other - Grime - Large / (R) Front Floor Mat - Grime - Medium</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (R) Front Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Repair mark - Yes / Bonnet, Headlight - Scratch - Large / (L) Front Fender, Molding - Scratch - Small / (L) Mirror - Scratch - Small / (L) Rear Door, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Roof Spoiler, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Mirror - Faded(Color, Gloss) - Yes / (R) Mirror - Scratch - Small / (R) Front Fender, Molding - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Roof - Scratch - Large</p>
Frame Evaluation : D	Functional Evaluation : B
<p>Remarks Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Right Center Pillar - Traces of Bending, or Marks of Panel Repair ? - Yes / Right Front Pillar - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Retractable Mirror - Issue - Yes</p>

<p>Inspector Notes</p>
<p>Right sidemirror issue. Right front and rear door repaired. With warranty booklet, spare tire, jack and seat cover. Without tools. 2 keys. With LTO plate.</p>