

General Information

Date & Time: 20, Jan, 2026 10:06

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	24,207
Registration No.	NEY3374	Chassis No.	PA1B18F36R4256286
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



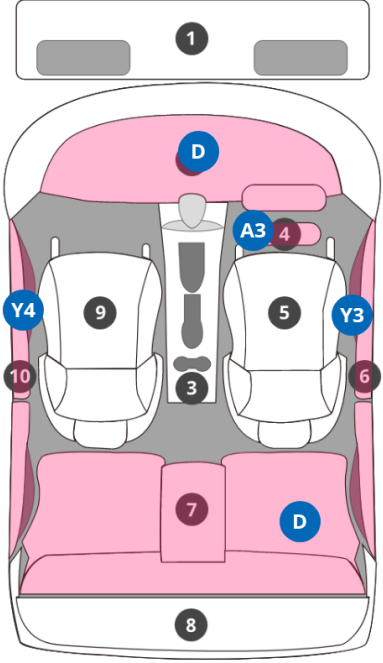
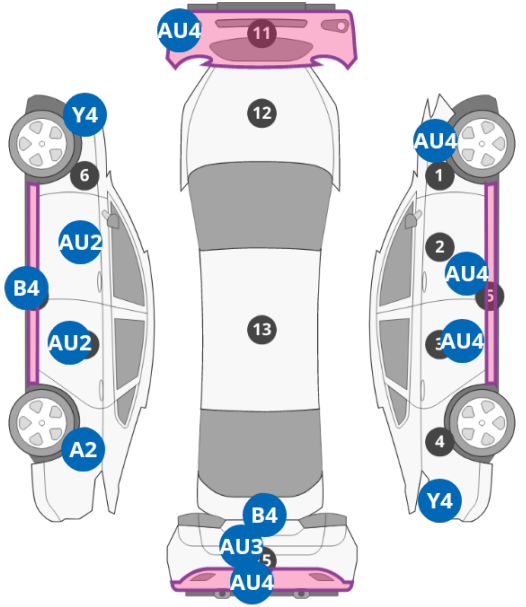
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	107.0	108	106	107
2	Boot Lid	107.6	115	106	102
3	Roof	99.4	101	97	92/107
4	Left Front Fender	97.1	103	98	90
5	Left Front Door	98.3	95	101	99
6	Center Panel Left				
7	Left Rear Door	107.5	119	108	96
8	Left Back Panel	104.3	107	104	102
9	Right Front Fender	107.0	111	110	100
10	Right Front Door	100.9	100	99	104
11	Center Panel Right				
12	Right Rear Door	147.6	100	221	122
13	Right Back Panel	108.3	104	105	116

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Trim - Grime - Large / (R) Front Trim - Grime - Medium / Dashboard - Traces of Adhesive Tape - Yes / Rear Seat - Repair Mark - Yes / Overall Interior - Worn as per age - Yes / (L) Front Floor Mat - Cut, Crack - Medium</p>	<p>Remarks (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Step - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (R) Front Fender, Molding - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Repair mark - Difference in Color / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Modified - Large / (R) Rear Fender, Molding - Crack, Gap - Large / (L) Step, In-panel, Side Spoiler - Modified - Large / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (L) Front Fender, Molding - Crack, Gap - Large / (L) Front Door, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Repair mark - Yes / (R) Step, In-panel, Side Spoiler - Repair mark - Yes</p>
Frame Evaluation : B	Functional Evaluation : B
<p>Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Battery - Weak - Yes / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>no warranty booklet / no LTO plate/ incomplete tools/ with jack and no tools/ no spare tire/ head light issue/ reverse light issue/</p>