

General Information

Date & Time: 19, Jan, 2026 13:58

Make	Nissan	Model	Navara
YOM	2019	Odo Meter Reading	88,744
Registration No.	LAD7128	Chassis No.	MNTCC2023Z0055930
CC	2.5	Transmission	M/T
Fuel Type	Diesel	Type of Body	Pickup
Colour	Silver		

Body / Panel Condition



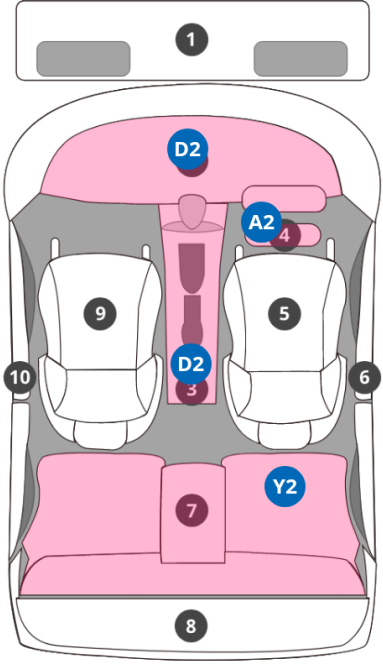
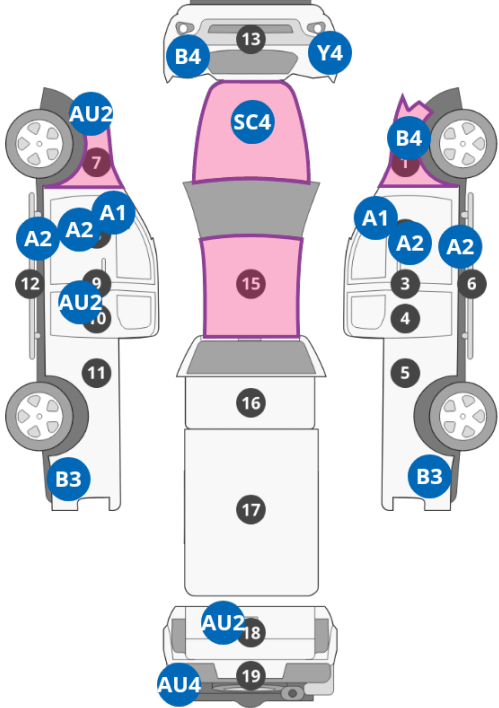
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	115.0	118	138	89
2	Boot Lid	769.3	381	789	1,138
3	Roof	166.7	217	240	104/106
4	Left Front Fender	184.0	225	162	165
5	Left Front Door	136.0	132	136	140
6	Center Panel Left				
7	Left Rear Door	130.6	145	134	113
8	Left Back Panel	125.6	115	118	144
9	Right Front Fender	155.4	94	175	197
10	Right Front Door	138.0	142	144	128
11	Center Panel Right				
12	Right Rear Door	140.0	124	152	144
13	Right Back Panel	102.6	123	99	86

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Glove Box - Loose, Deformed - Small / Rear Seat - Grime - Small / (L) Front Floor Mat - Cut, Crack - Small / Console, Switchs, Vents - Loose, Deformed - Small</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Corner Panel - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Front Fender, Molding - Repair mark - Difference in Color / (R) Front Fender, Molding - Modified - Large / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / Overall Exterior - Full Re-Paint in same color - Yes / (R) Side Gate - Modified - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Rear Gate - Scratch & Dent - Small / (L) Side Gate - Modified - Medium / Roof - Repair mark - Difference in Color / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Repair mark - Difference in Color / (L) Front Fender, Molding - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Modified - Large / Bonnet, Headlight - Repair mark - Difference in Color / Bonnet, Headlight - Rust, Corrosion - Large / Front Bumper, Grille, Lamps - Crack, Gap - Large</p>
Frame Evaluation : A	Functional Evaluation : D
<p>Remarks Defects not found</p>	<p>Remarks Power Window (each) - Stuck, Gap - Yes / Door Lock - Issue - Yes / Air Conditioner - Function - Weak / Battery - Weak - Yes / Turn Signal, Hazard Flasher - Issue - Yes / Horn - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>With Lto plate, with spare tire, 1key, no warranty booklet, no jack and tools, front bumper logo missing, aircon issue, battery weak, cover under hood missing</p>