

## General Information

Date & Time: 20, Jan, 2026 16:28

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2023	<b>Odo Meter Reading</b>	103,581
<b>Registration No.</b>	NHJ9982	<b>Chassis No.</b>	PA1B18F34P4221713
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Green		

## Body / Panel Condition



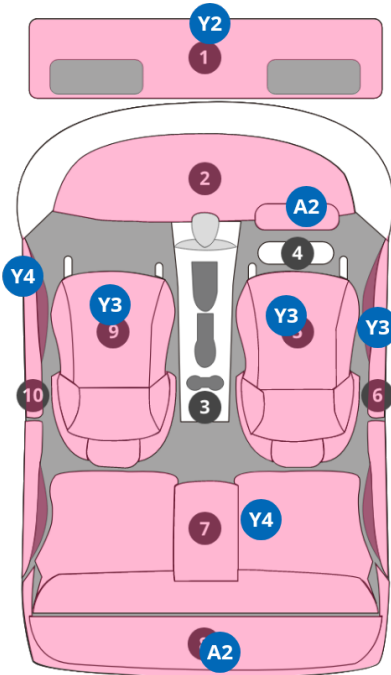
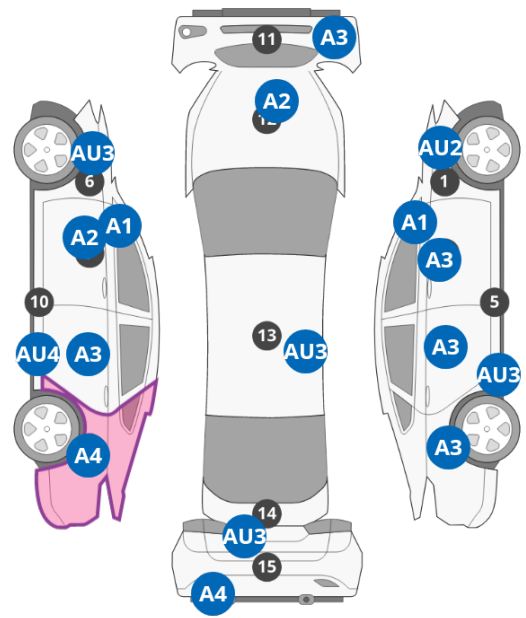
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	104.0	113	94	105
2	Boot Lid	101.8	91	105	110
3	Roof	93.3	90	85	103/95
4	Left Front Fender	121.0	117	125	121
5	Left Front Door	141.6	157	145	123
6	Center Panel Left				
7	Left Rear Door	138.6	118	131	167
8	Left Back Panel	745.3	992	1,101	143
9	Right Front Fender	96.3	98	96	95
10	Right Front Door	98.9	100	98	99
11	Center Panel Right				
12	Right Rear Door	102.5	98	100	110
13	Right Back Panel	95.5	97	91	99

Overall Evaluation :

**D**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b>	C	<b>Exterior Evaluation :</b>	E
			
<p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>		<p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>	
<p><b>Remarks</b> (R) Front Seat - Grime - Medium / (R) Front Trim - Grime - Medium / Rear Seat - Grime - Large / Trunk Room - Worn, Scratch, Cut, Crack - Small / (L) Front Trim - Grime - Large / (L) Front Seat - Grime - Medium / Steering Wheel - Worn, Peel, Crack - Small / Ceiling - Grime - Small</p>		<p><b>Remarks</b> (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Trunk Hood, Rear Gate - Scratch &amp; Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Large / (L) Rear Fender, Molding - Repair mark - Yes / (L) Rear Fender, Molding - Scratch - Large / (L) Rear Door, Molding - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Large / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch &amp; Dent - Medium / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Front Fender, Molding - Scratch &amp; Dent - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Medium / (R) Rear Fender, Molding - Scratch - Medium / Roof - Scratch &amp; Dent - Medium</p>	
<b>Frame Evaluation :</b>	D	<b>Functional Evaluation :</b>	B
<p><b>Remarks</b> Rear Side Member &amp; Trunk Room Floor - Condition of Welding, Hardness and Shape of Sealant ? - Yes</p>		<p><b>Remarks</b> Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>	

<b>Inspector Notes</b>
with LTO plate/with spare tire/No spare key/No reverse camera/No warranty booklet/plate light issue/No seat cover/with jack No tools/possible flooding/left side rear fender traces of welding