

## General Information

Date & Time: 21, Jan, 2026 13:13

<b>Make</b>	Toyota	<b>Model</b>	Avanza
<b>YOM</b>	2024	<b>Odo Meter Reading</b>	42,594
<b>Registration No.</b>	NHM8481	<b>Chassis No.</b>	MHFAA1BY0R0023225
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	MPV
<b>Colour</b>	Silver		

## Body / Panel Condition



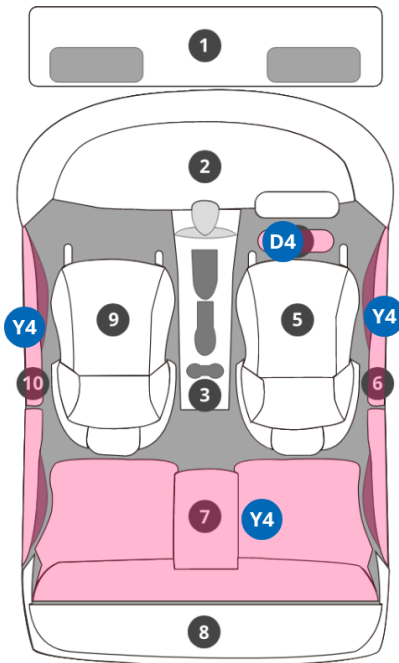
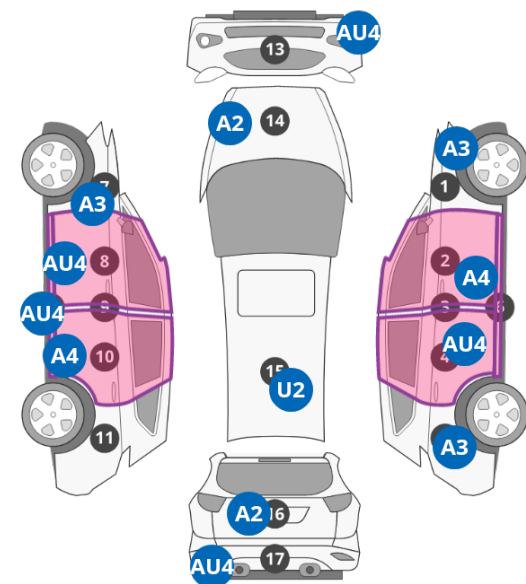
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	98.3	100	101	94
2	Boot Lid	90.0	80	100	90
3	Roof	104.8	108	107	97/107
4	Left Front Fender	89.6	90	90	89
5	Left Front Door	123.6	104	126	141
6	Center Panel Left				
7	Left Rear Door	117.0	135	105	111
8	Left Back Panel	105.3	116	108	92
9	Right Front Fender	98.0	103	100	91
10	Right Front Door	122.6	147	118	103
11	Center Panel Right				
12	Right Rear Door	147.0	139	144	158
13	Right Back Panel	103.0	100	96	114

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Rear Seat - Grime - Large / (R) Front Trim - Grime - Large / (L) Front Trim - Grime - Large / (L) Front Floor Mat - Worked - Large</p>	<p><b>Remarks</b> (L) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Large / (L) Front Door, Molding - Scratch &amp; Dent - Large / (L) Rear Door, Molding - Scratch - Large / (L) Rear Door, Molding - Repair mark - Yes / (L) Front Door, Molding - Repair mark - Yes / (L) Front Fender, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch &amp; Dent - Large / (R) Rear Door, Molding - Repair mark - Yes / (R) Front Door, Molding - Repair mark - Yes / (R) Front Fender, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch - Large / (R) Rear Door, Molding - Scratch &amp; Dent - Large / (R) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Large / Trunk Hood, Rear Gate - Scratch - Small / Roof - Dent - Small / Bonnet, Headlight - Scratch - Small / (R) Step, In-panel, Side Spoiler - Repair mark - Yes / (L) Step, In-panel, Side Spoiler - Repair mark - Yes</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Retractable Mirror - Issue - Yes / Battery - Weak - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>no warranty booklet/ no jack and tools/ possible flooding/ with spare tire and jack</p>