

## General Information

Date & Time: 21, Jan, 2026 13:24

<b>Make</b>	Honda	<b>Model</b>	CRV
<b>YOM</b>	2018	<b>Odo Meter Reading</b>	19,743
<b>Registration No.</b>	FAD6655	<b>Chassis No.</b>	MRHRW7870JP021236
<b>CC</b>	1.6	<b>Transmission</b>	A/T
<b>Fuel Type</b>	Diesel	<b>Type of Body</b>	SUV
<b>Colour</b>	Silver		

## Body / Panel Condition



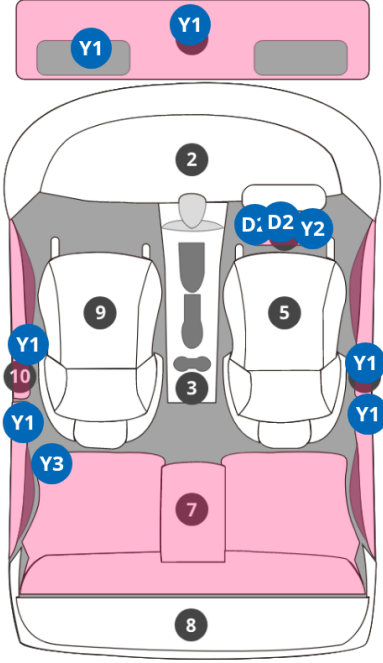
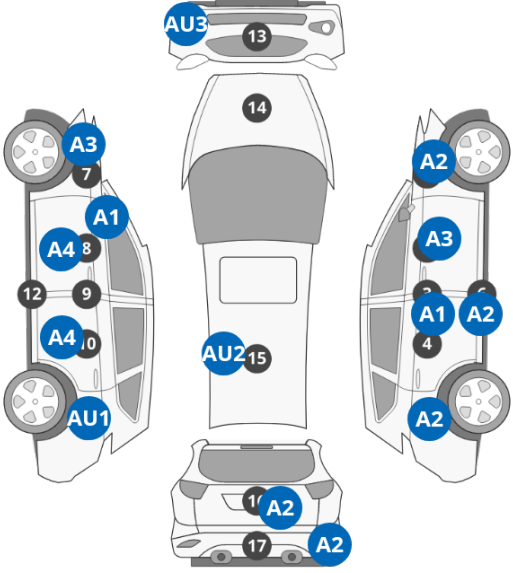
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	124.6	121	132	121
2	Boot Lid	101.3	97	111	96
3	Roof	112.2	118	116	108/107
4	Left Front Fender	114.3	112	110	121
5	Left Front Door	121.3	122	124	118
6	Center Panel Left				
7	Left Rear Door	123.3	130	122	118
8	Left Back Panel	129.3	135	131	122
9	Right Front Fender	118.6	127	112	117
10	Right Front Door	131.6	136	131	128
11	Center Panel Right				
12	Right Rear Door	131.6	121	132	142
13	Right Back Panel	128.3	130	128	127

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (R) Front Trim - Grime - Minimal / (R) Front Floor Mat - Grime - Small / Sunvisor, Sunglass Holder - Grime - Minimal / Ceiling - Grime - Minimal / (R) Rear Trim - Grime - Minimal / (L) Rear Trim - Grime - Minimal / Rear Seat - Grime - Medium / (L) Front Trim - Grime - Minimal / (L) Front Floor Mat - Worked - Small / Mat Other - Worked - Small</p>	<p><b>Remarks</b> (L) Front Fender, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Large / (L) Mirror - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Large / (L) Rear Fender, Molding - Scratch &amp; Dent - Minimal / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch &amp; Dent - Medium / Roof - Scratch &amp; Dent - Small</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>With warranty booklet. Without spare tire, jack and tools. 1 key. With LTO plate.</p>