

## General Information

Date & Time: 19, Jan, 2026 13:59

<b>Make</b>	Honda	<b>Model</b>	City
<b>YOM</b>	2016	<b>Odo Meter Reading</b>	57,324
<b>Registration No.</b>	ABI6117	<b>Chassis No.</b>	PADGM6630GV206296
<b>CC</b>	1.5	<b>Transmission</b>	A/T
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Gray		

## Body / Panel Condition



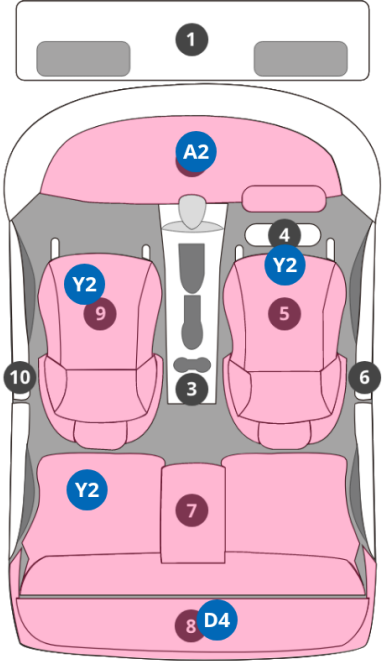
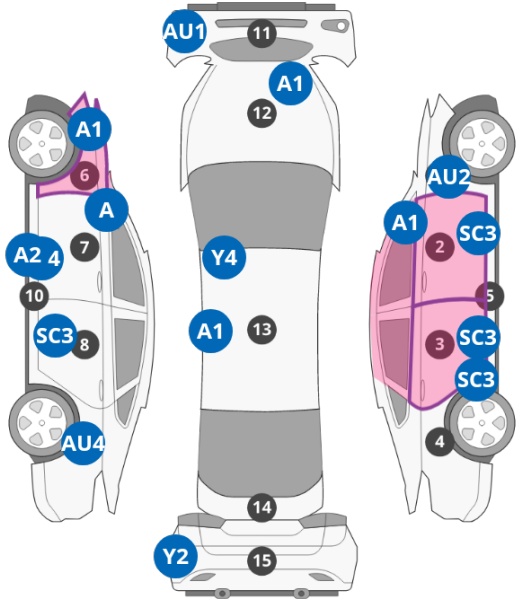
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	90.0	93	97	79
2	Boot Lid	103.4	114	85	111
3	Roof	94.7	88	107	88/96
4	Left Front Fender	169.0	267	127	113
5	Left Front Door	107.7	129	95	99
6	Center Panel Left				
7	Left Rear Door	100.2	98	96	106
8	Left Back Panel	108.0	104	111	109
9	Right Front Fender	118.6	121	118	117
10	Right Front Door	444.0	892	310	130
11	Center Panel Right				
12	Right Rear Door	415.0	134	146	965
13	Right Back Panel	129.0	123	132	132

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (R) Front Seat - Grime - Small / Trunk Room - Loose, Deformed - Large / Rear Seat - Grime - Small / (L) Front Seat - Grime - Small / Steering Wheel - Worn, Peel, Crack - Small</p>	<p><b>Remarks</b> (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Front Windshield - Damaged - Large / Overall Exterior - Full Re-Paint in same color - Yes / (R) Mirror - Scratch, Peeled - Minimal / (R) Front Fender, Molding - Scratch &amp; Dent - Small / (R) Front Door, Molding - Repair mark - Difference in Color / (R) Rear Door, Molding - Repair mark - Difference in Color / (R) Front Door, Molding - Rust, Corrosion - Medium / (R) Rear Door, Molding - Rust, Corrosion - Medium / (R) Rear Fender, Molding - Rust, Corrosion - Medium / Trunk Hood, Rear Gate - Crack, Gap - Small / (L) Rear Fender, Molding - Scratch &amp; Dent - Large / (L) Rear Door, Molding - Rust, Corrosion - Medium / (L) Front Door, Molding - Rust, Corrosion - Large / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Mirror - Scratch, Peeled - Yes / (L) Front Fender, Molding - Repair mark - Yes / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch &amp; Dent - Minimal / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Minimal</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>With Lto plate, with spare tire, with warranty booklet, 1key, no jack and tools, truck cover missing, scratches on headlights and taillights</p>