

## General Information

Date & Time: 20, Jan, 2026 18:16

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2024	<b>Odo Meter Reading</b>	26,434
<b>Registration No.</b>	NKC8397	<b>Chassis No.</b>	PA1B18F38R4254605
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Black		

## Body / Panel Condition



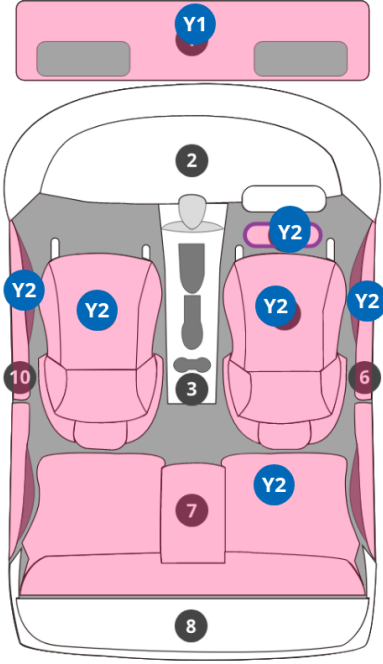
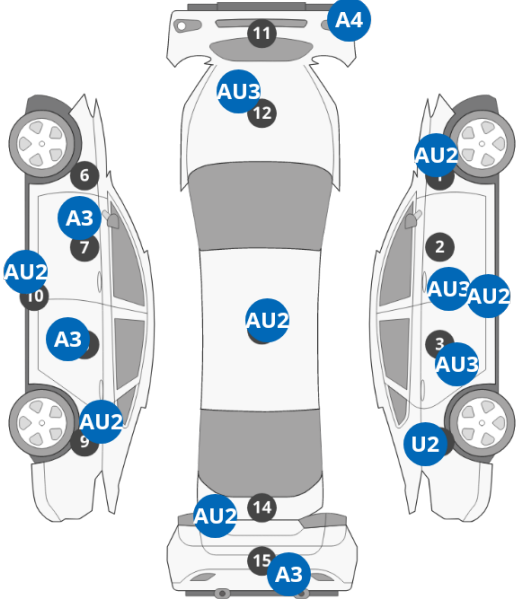
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	107.9	94	102	128
2	Boot Lid	119.6	112	114	133
3	Roof	110.5	112	120	100/110
4	Left Front Fender	108.6	102	112	112
5	Left Front Door	108.0	109	101	114
6	Center Panel Left				
7	Left Rear Door	117.6	131	112	110
8	Left Back Panel	114.4	133	111	99
9	Right Front Fender	114.0	122	111	109
10	Right Front Door	103.6	109	100	102
11	Center Panel Right				
12	Right Rear Door	112.0	111	105	120
13	Right Back Panel	122.0	102	109	155

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>B</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>E</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (L) Front Floor Mat - Missing - Yes / (R) Front Floor Mat - Grime - Small / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small / Rear Seat - Grime - Small / (R) Front Seat - Grime - Small / (L) Front Seat - Grime - Small / Ceiling - Grime - Minimal</p>	<p><b>Remarks</b> (L) Front Door, Molding - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Small / (L) Rear Door, Molding - Scratch - Medium / (L) Rear Fender, Molding - Scratch &amp; Dent - Small / Trunk Hood, Rear Gate - Scratch &amp; Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / (R) Rear Fender, Molding - Dent - Small / (R) Rear Door, Molding - Scratch &amp; Dent - Medium / (R) Front Door, Molding - Scratch &amp; Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Small / Roof - Scratch &amp; Dent - Small / Front Bumper, Grille, Lamps - Scratch - Large / (R) Front Fender, Molding - Scratch &amp; Dent - Small / Bonnet, Headlight - Scratch &amp; Dent - Medium</p>
<b>Frame Evaluation :</b> <span style="float: right;"><b>A</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>A</b></span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>with LTO plate with reverse camera, no tools and jack, no warranty and manual booklet, no spare key, scratches on taillight and headlight.</p>