

## General Information

Date & Time: 20, Jan, 2026 12:28

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2024	<b>Odo Meter Reading</b>	20,957
<b>Registration No.</b>	DBO3995	<b>Chassis No.</b>	PA1B18F37R4239738
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Silver		

## Body / Panel Condition



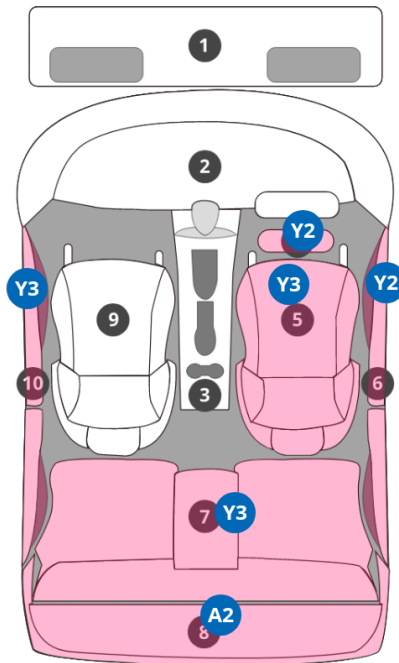
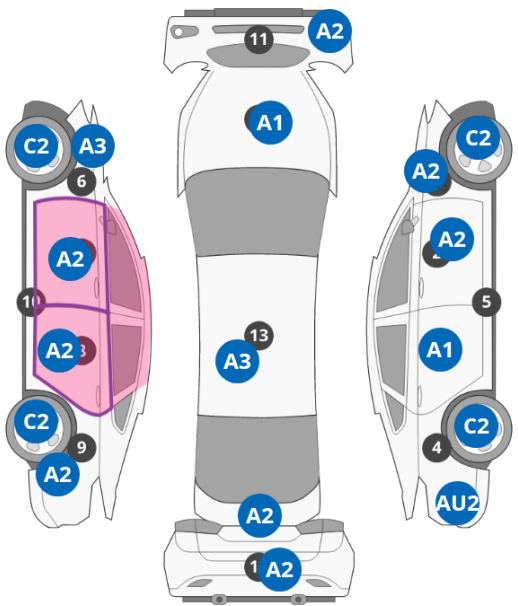
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	109.4	122	98	108
2	Boot Lid	99.7	97	100	103
3	Roof	87.4	97	86	85/82
4	Left Front Fender	92.0	89	87	100
5	Left Front Door	179.0	188	179	170
6	Center Panel Left				
7	Left Rear Door	180.3	190	167	184
8	Left Back Panel	105.2	116	100	100
9	Right Front Fender	96.0	101	94	93
10	Right Front Door	94.2	97	94	92
11	Center Panel Right				
12	Right Rear Door	93.0	88	94	97
13	Right Back Panel	95.8	90	101	97

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>B</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>D</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (R) Front Seat - Grime - Medium / (R) Front Trim - Grime - Small / Rear Seat - Grime - Medium / Trunk Room - Worn, Scratch, Cut, Crack - Small / (L) Front Trim - Grime - Medium / (L) Front Floor Mat - Grime - Small</p>	<p><b>Remarks</b> (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / Roof - Scratch - Medium / (L) Front Door, Molding - Repair mark - Yes / (L) Rear Door, Molding - Repair mark - Yes / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch &amp; Dent - Small / (L) Rear Wheel, Cover - Scratch, Corrosion - Small / (L) Front Wheel, Cover - Scratch, Corrosion - Small / (R) Front Wheel, Cover - Scratch, Corrosion - Small / (R) Rear Wheel, Cover - Scratch, Corrosion - Small</p>
<b>Frame Evaluation :</b> <span style="float: right;"><b>A</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>B</b></span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>with LTO plate/with spare tire/No spare key/with jack and incomplete tools/No warranty booklet/No reverse camera /No seat cover/unusual sound engine</p>