

General Information

Date & Time: 26, Jan, 2026 08:51

Make	Toyota	Model	Rush
YOM	2022	Odo Meter Reading	122,427
Registration No.	DAP8584	Chassis No.	MHKE8FF3PNK040603
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	SUV
Colour	Red Mica Metallic		

Body / Panel Condition



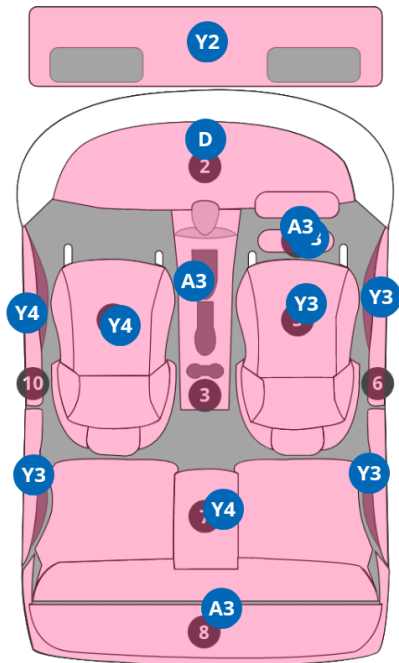
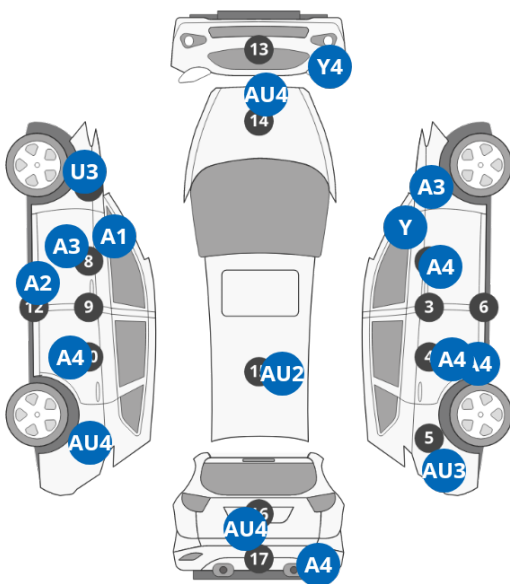
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	157.3	166	136	170
2	Boot Lid	83.6	90	80	81
3	Roof	89.6	76	85	97/100
4	Left Front Fender	232.6	264	233	201
5	Left Front Door	103.5	101	110	100
6	Center Panel Left				
7	Left Rear Door	102.6	103	103	102
8	Left Back Panel	96.2	99	97	92
9	Right Front Fender	99.9	103	103	94
10	Right Front Door	100.0	100	101	99
11	Center Panel Right				
12	Right Rear Door	91.5	89	93	93
13	Right Back Panel	90.3	91	90	90

Overall Evaluation :

E

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : E	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Medium / (R) Front Trim - Grime - Medium / Rear Seat - Grime - Large / Mat Other - Crinkle - Medium / (R) Rear Trim - Grime - Medium / Trunk Room - Worn, Scratch, Cut, Crack - Medium / (L) Rear Trim - Grime - Medium / (L) Front Trim - Grime - Large / (L) Front Seat - Grime - Large / (L) Front Floor Mat - Cut, Crack - Medium / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Medium / Dashboard - Traces of Adhesive Tape - Yes / Ceiling - Grime - Small</p>	<p>Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / Bonnet, Headlight - Scratch & Dent - Large / Front Bumper, Grille, Lamps - Crack, Gap - Large / (R) Front Fender, Molding - Scratch - Medium / (R) Mirror - Crack - Damaged / (R) Front Door, Molding - Scratch - Large / (R) Step, In-panel, Side Spoiler - Scratch - Large / (R) Rear Door, Molding - Scratch - Large / (R) Rear Fender, Molding - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch - Large / (L) Rear Fender, Molding - Scratch & Dent - Large / (L) Rear Door, Molding - Scratch - Large / (L) Front Door, Molding - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Dent - Medium / Roof - Scratch & Dent - Small</p>
Frame Evaluation : B	Functional Evaluation : D
<p>Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Power Window (each) - Stuck, Gap - Yes / Air Conditioner - Function - Weak / Battery - Weak - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate/with spare tire/No spare key/No jack and tools/with reverse camera/signal lights issue/left side tail light crack/front right side mirror damage/No warranty booklet/possible flooding/interior dirty/engine noise/vibration/front right side window issue/cross member support traces of dent/aircon issue</p>