

## General Information

**Date & Time: 21, Jan, 2026 15:09**

<b>Make</b>	Toyota	<b>Model</b>	Hiace
<b>YOM</b>	2021	<b>Odo Meter Reading</b>	77,407
<b>Registration No.</b>	DAU7318	<b>Chassis No.</b>	JTFJT02P5M0014852
<b>CC</b>	3.0	<b>Transmission</b>	M/T
<b>Fuel Type</b>	Diesel	<b>Type of Body</b>	Van
<b>Colour</b>	Silver		

## Body / Panel Condition



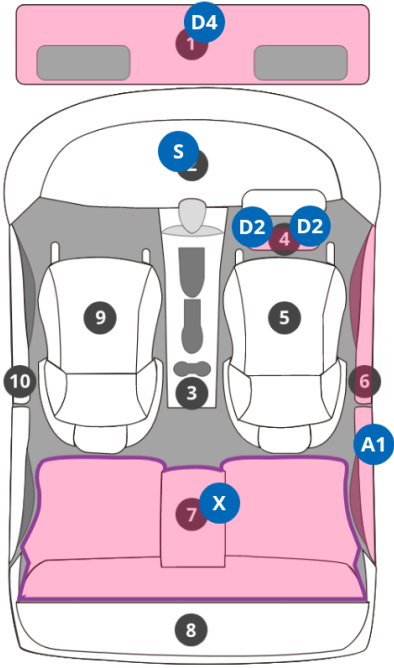
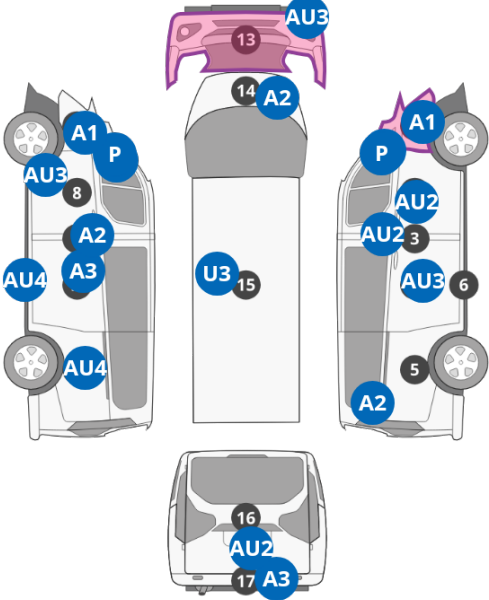
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	<b>112.6</b>	106	115	117
2	Boot Lid	<b>157.0</b>	143	156	172
3	Roof	<b>113.2</b>	121	115	108/109
4	Left Front Fender	<b>195.3</b>	160	246	180
5	Left Front Door	<b>142.6</b>	151	151	126
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	<b>122.6</b>	123	120	125
9	Right Front Fender	<b>124.6</b>	124	121	129
10	Right Front Door	<b>163.0</b>	187	151	151
11	Center Panel Right	<b>291.0</b>	150	491	232
12	Right Rear Door	<b>186.6</b>	188	179	193
13	Right Back Panel	<b>177.6</b>	212	165	156

**Overall Evaluation :**

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">C</span>	<b>Exterior Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Overall Interior - Worn as per age - Yes / Overall Interior - Smell - Yes / Rear Seat - Missing - Yes / Ceiling - Crinkle - Large / (R) Rear Trim - Cut, Crack - Minimal / (L) Front Floor Mat - Worked - Small / (R) Front Floor Mat - Worked - Small</p>	<p><b>Remarks</b> (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (R) Center Panel - Repair Traces - Yes / Overall Exterior - Full Re-Paint in same color - Yes / Front Bumper, Grille, Lamps - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Small / (R) Mirror - Faded(Color, Gloss) - Yes / (R) Front Door, Molding - Scratch &amp; Dent - Small / (R) Center Panel - Scratch &amp; Dent - Small / (R) Rear Door, Molding - Scratch &amp; Dent - Medium / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch &amp; Dent - Small / (L) Rear Fender, Molding - Scratch &amp; Dent - Large / (L) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Large / (L) Rear Door, Molding - Scratch - Medium / (L) Center Panel - Scratch - Small / (L) Mirror - Scratch - Small / (L) Mirror - Faded(Color, Gloss) - Yes / (L) Front Door, Molding - Scratch &amp; Dent - Medium / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch &amp; Dent - Medium / Front Panel - Scratch - Small / Roof - Dent - Medium</p>
<b>Frame Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">A</span>	<b>Functional Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">A</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>with warranty booklet, jack, and incomplete tools, with spare tire, with LTO plate, scratches on tail light, reverse and signal light issue, all rear seat missing, dome light issue, abnormal noise on engine when starting</p>