

## General Information

Date & Time: 22, Jan, 2026 08:58

<b>Make</b>	Toyota	<b>Model</b>	Wigo
<b>YOM</b>	2023	<b>Odo Meter Reading</b>	57,473
<b>Registration No.</b>	DBG1056	<b>Chassis No.</b>	MHKA4DF5FNJ075692
<b>CC</b>	1.0	<b>Transmission</b>	A/T
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Hatchback
<b>Colour</b>	Black		

## Body / Panel Condition



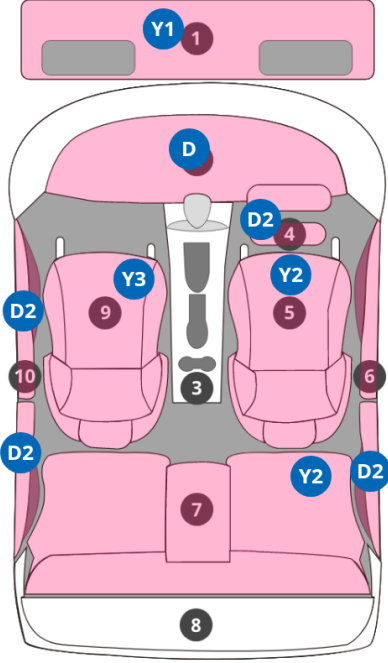
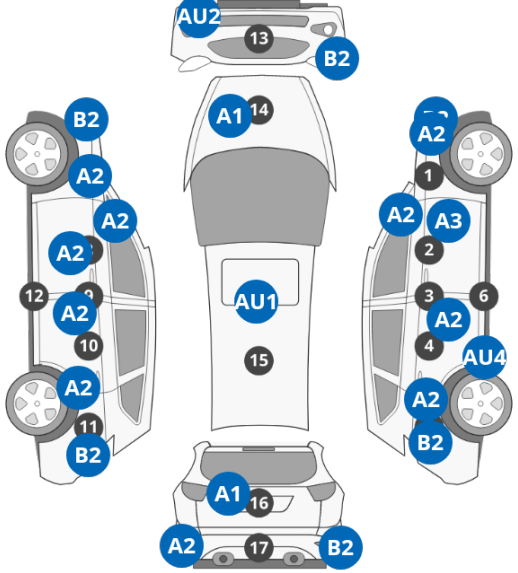
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	101.1	109	98	96
2	Boot Lid	99.4	95	104	99
3	Roof	88.8	89	93	90/84
4	Left Front Fender	155.0	152	158	155
5	Left Front Door	147.0	156	154	131
6	Center Panel Left				
7	Left Rear Door	113.7	101	98	142
8	Left Back Panel	100.0	103	95	102
9	Right Front Fender	99.5	103	100	96
10	Right Front Door	99.8	99	102	99
11	Center Panel Right				
12	Right Rear Door	97.9	100	99	96
13	Right Back Panel	96.1	99	96	93

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (R) Front Seat - Grime - Small / (L) Front Seat - Grime - Medium / (L) Front Floor Mat - Worked - Small / (R) Rear Trim - Worked - Small / (L) Rear Trim - Worked - Small / (L) Front Trim - Worked - Small / Rear Seat - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes / Ceiling - Grime - Minimal</p>	<p><b>Remarks</b> (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Large / (R) Front Fender, Molding - Modified - Small / (R) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Modified - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Modified - Small / Rear Bumper, Lamps, Panels - Modified - Small / (L) Rear Fender, Molding - Modified - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Small / (L) Front Fender, Molding - Modified - Small / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch &amp; Dent - Small / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch &amp; Dent - Minimal</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Defects not found</p>

<p><b>Inspector Notes</b></p>
<p>with warranty booklet, jack and tools, with spare tire, with LTO plate, scratches on tail light and headlight</p>