

General Information

Date & Time: 22, Jan, 2026 08:10

Make	Toyota	Model	Avanza
YOM	2019	Odo Meter Reading	78,554
Registration No.	FAH5451	Chassis No.	MHKM6EE2FJK012729
CC	1.3	Transmission	M/T
Fuel Type	Gas	Type of Body	Wagon
Colour	Gray		

Body / Panel Condition



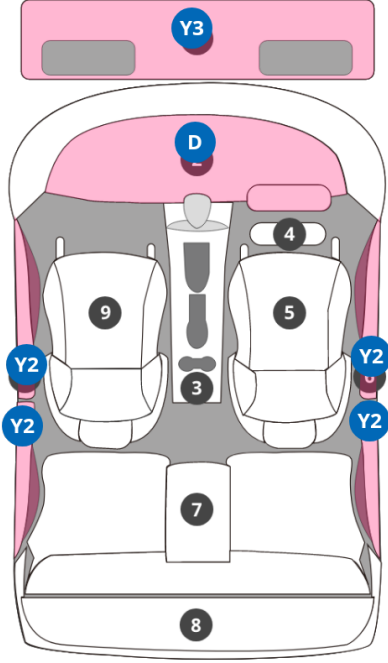
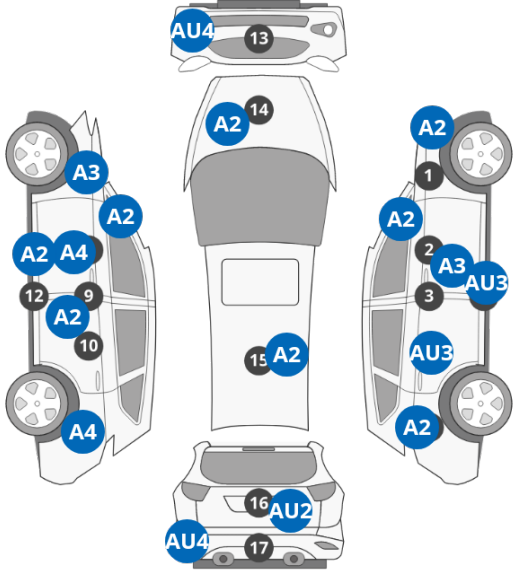
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	134.3	133	141	129
2	Boot Lid	154.0	150	153	159
3	Roof	178.5	101	387	110/116
4	Left Front Fender	132.6	120	131	147
5	Left Front Door	126.6	129	133	118
6	Center Panel Left				
7	Left Rear Door	128.0	128	134	122
8	Left Back Panel	116.6	127	110	113
9	Right Front Fender	133.3	143	130	127
10	Right Front Door	139.3	141	149	128
11	Center Panel Right				
12	Right Rear Door	143.3	144	139	147
13	Right Back Panel	130.0	122	124	144

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Trim - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes / (L) Rear Trim - Grime - Small / Ceiling - Grime - Medium / (R) Rear Trim - Grime - Small / (R) Front Trim - Grime - Small</p>	<p>Remarks Trunk Hood, Rear Gate - Repair Traces - Yes / Roof - Repair Traces - Yes / Overall Exterior - Faded(Color, Gloss) - Yes / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Mirror - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Large / (L) Mirror - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Front Fender, Molding - Scratch - Medium / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Front Fender, Molding - Scratch - Small / Roof - Scratch - Small</p>
Frame Evaluation : B	Functional Evaluation : A
<p>Remarks Right Tyre House - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Reverse Camera - N/A - Yes / Parking Brake - Function - Weak / Spare Key - Issue - Unexist</p>

Inspector Notes	
<p>Front seat driver side loose. Parking break loose and issue. With warranty booklet, spare tire and seat cover. Without jack and tools. 1 key. With LTO plate.</p>	