

## General Information

Date & Time: 23, Jan, 2026 08:50

<b>Make</b>	Toyota	<b>Model</b>	Wigo
<b>YOM</b>	2020	<b>Odo Meter Reading</b>	51,012
<b>Registration No.</b>	FAG5852	<b>Chassis No.</b>	MHKA4DF5FKJ035099
<b>CC</b>	1.0	<b>Transmission</b>	A/T
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Hatchback
<b>Colour</b>	Red		

## Body / Panel Condition



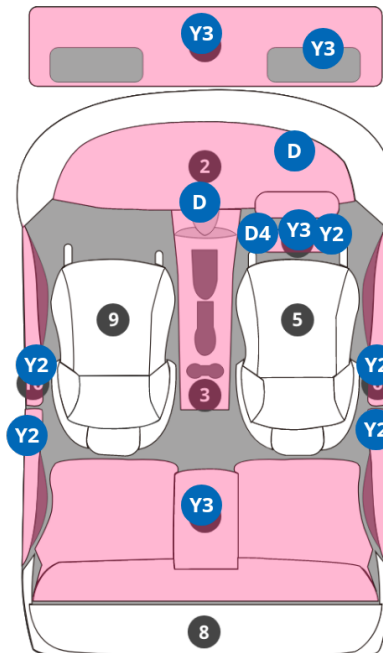
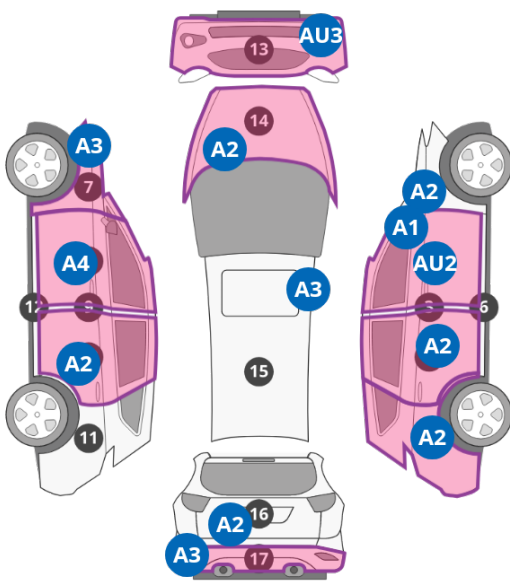
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	130.6	121	138	133
2	Boot Lid	111.0	114	109	110
3	Roof	110.3	98	111	119/113
4	Left Front Fender	197.6	200	203	190
5	Left Front Door	242.0	238	242	246
6	Center Panel Left				
7	Left Rear Door	263.0	251	228	310
8	Left Back Panel	209.6	251	207	171
9	Right Front Fender	142.0	157	139	130
10	Right Front Door	250.0	294	224	232
11	Center Panel Right				
12	Right Rear Door	219.6	188	221	250
13	Right Back Panel	247.0	477	127	137

## Overall Evaluation :

**E**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">D</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
<div style="text-align: center;">  </div> <p><b>a :</b> Cut, Fray <b>d :</b> Loose, Deformed <b>k :</b> Animal Hair <b>s :</b> Smell <b>t :</b> Cigarette Burns <b>x :</b> Defective <b>y :</b> Stain</p>	<div style="text-align: center;">  </div> <p><b>A :</b> Scratch <b>AU :</b> Scratch &amp; Dent <b>B :</b> Modified <b>C :</b> Corrosion <b>G :</b> Stone chip <b>P :</b> Faded <b>S :</b> Rust <b>SC :</b> Rust &amp; Corrosion <b>U :</b> Dent <b>X :</b> Defective <b>Y :</b> Crack, Gap</p>
<p><b>Remarks</b></p> <p>(L) Front Trim - Grime - Small / (L) Front Floor Mat - Worked - Large / Dashboard - Traces of Adhesive Tape - Yes / Console, Switchs, Vents - Traces of Adhesive Tape - Yes / Sunvisor, Sunglass Holder - Grime - Medium / Ceiling - Grime - Medium / Mat Other - Grime - Medium / Rear Seat - Grime - Medium / (L) Rear Trim - Grime - Small / (R) Rear Trim - Grime - Small / (R) Front Trim - Grime - Small / (R) Front Floor Mat - Grime - Small</p>	<p><b>Remarks</b></p> <p>(R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (L) Front Door, Molding - Repair mark - Yes / (R) Front Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Repair mark - Yes / (L) Rear Door, Molding - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Repair mark - Yes / Front Bumper, Grille, Lamps - Repair mark - Yes / (L) Front Fender, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Large / Trunk Hood, Rear Gate - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch - Medium / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch &amp; Dent - Small / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / Bonnet, Headlight - Repair mark - Yes / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch &amp; Dent - Medium / Roof - Scratch - Medium</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">D</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>
<p><b>Remarks</b></p> <p>Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes / Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Pillar - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Center Pillar - Traces of Bending, or Marks of Panel Repair ? - Yes / Right Center Pillar - Traces of Bending, or Marks of Panel Repair ? - Yes / Right Tyre House - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Inside (Rear Side) - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p><b>Remarks</b></p> <p>Retractable Mirror - Issue - Yes / Warning Lamps - Issue - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

**Inspector Notes**

Check engine. right side mirror retractable issue. Left reverse light not working. Gap at front bumper, rear bumper, right front door, rear left door and bonnet. Deformed trunk floor. Without warranty booklet and tools. With spare tire, jack and seat cover. 1 key. With LTO plate.