

## General Information

Date & Time: 26, Jan, 2026 18:04

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2025	<b>Odo Meter Reading</b>	27,672
<b>Registration No.</b>	NHU8745	<b>Chassis No.</b>	PA1B18F34R4277444
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Red Mica Metallic		

## Body / Panel Condition



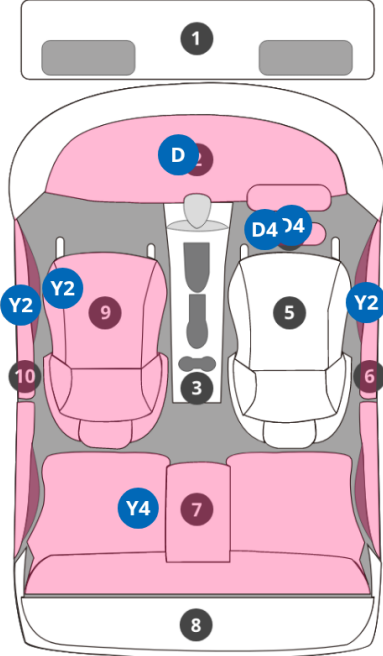
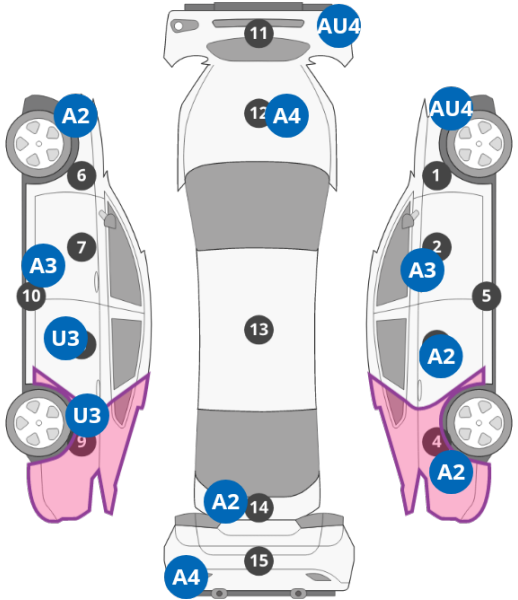
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	101.4	108	95	101
2	Boot Lid	100.6	92	100	110
3	Roof	86.8	87	91	78/91
4	Left Front Fender	96.9	99	95	96
5	Left Front Door	92.2	96	90	91
6	Center Panel Left				
7	Left Rear Door	94.8	102	94	89
8	Left Back Panel	102.6	106	108	94
9	Right Front Fender	107.6	109	109	105
10	Right Front Door	95.1	100	92	93
11	Center Panel Right				
12	Right Rear Door	99.2	95	94	109
13	Right Back Panel	106.3	104	105	110

## Overall Evaluation :

**D**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Rear Seat - Grime - Large / (R) Front Floor Mat - Worked - Large / (R) Front Trim - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Worked - Large / (L) Front Seat - Grime - Small</p>	<p><b>Remarks</b> (L) Rear Door, Molding - Dent - Medium / (L) Rear Fender, Molding - Dent - Medium / (L) Front Door, Molding - Scratch - Medium / (L) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Large / Front Bumper, Grille, Lamps - Scratch &amp; Dent - Large / (R) Front Fender, Molding - Scratch &amp; Dent - Large / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Large / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Wheel, Cover - Cap Missing - Yes / (R) Rear Wheel, Cover - Cap Missing - Yes</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Retractable Mirror - Issue - Yes / Warning Lamps - Issue - Yes / Battery - Weak - Yes</p>

<p><b>Inspector Notes</b></p>
<p>driver side mirror issue/ traction control light on/ incomplete tools/ no warranty booklet/with jack and spare tire with LTO plate/</p>