

## General Information

Date & Time: 26, Jan, 2026 10:03

<b>Make</b>	Toyota	<b>Model</b>	Raize
<b>YOM</b>	2024	<b>Odo Meter Reading</b>	39,775
<b>Registration No.</b>	DBN7185	<b>Chassis No.</b>	MHKAB1BA8PJ069894
<b>CC</b>	1.2	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	SUV
<b>Colour</b>	Gray		

## Body / Panel Condition



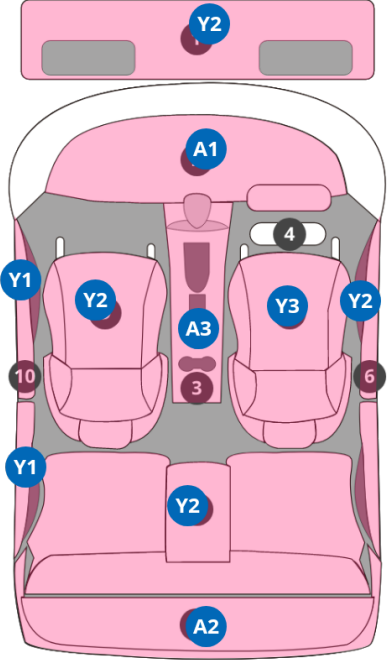
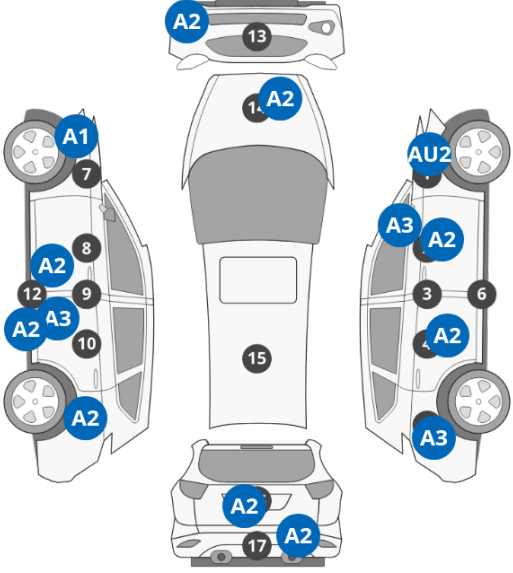
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	80.6	84	86	72
2	Boot Lid	83.0	77	93	79
3	Roof	85.0	89	88	77/86
4	Left Front Fender	87.4	71	97	95
5	Left Front Door	92.5	92	98	88
6	Center Panel Left				
7	Left Rear Door	91.0	96	92	85
8	Left Back Panel	79.7	79	79	82
9	Right Front Fender	91.3	91	97	86
10	Right Front Door	92.5	86	94	98
11	Center Panel Right				
12	Right Rear Door	84.0	82	80	90
13	Right Back Panel	81.7	87	80	78

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">D</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (R) Front Seat - Grime - Medium / (R) Front Trim - Grime - Small / Rear Seat - Grime - Small / Trunk Room - Worn, Scratch, Cut, Crack - Small / (L) Rear Trim - Grime - Minimal / (L) Front Trim - Grime - Minimal / (L) Front Seat - Grime - Small / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Medium / Ceiling - Grime - Small / Dashboard - Worn, Scratch, Cut, Crack - Minimal</p>	<p><b>Remarks</b> (L) Front Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Rear Fender, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Mirror - Scratch - Medium / (R) Front Fender, Molding - Scratch &amp; Dent - Small / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Battery - Weak - Yes</p>

<p><b>Inspector Notes</b></p>
<p>with LTO plate/with spare tire/with 2 key/with reverse camera/with warranty booklet/with seat cover/with jack and incomplete tools</p>