

General Information

Date & Time: 22, Jan, 2026 15:15

Make	Toyota	Model	Vios
YOM	2022	Odo Meter Reading	102,978
Registration No.	NGX1629	Chassis No.	PA1B18F33N4171545
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



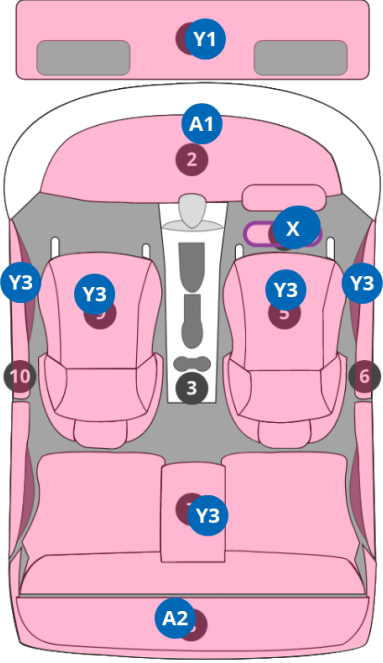
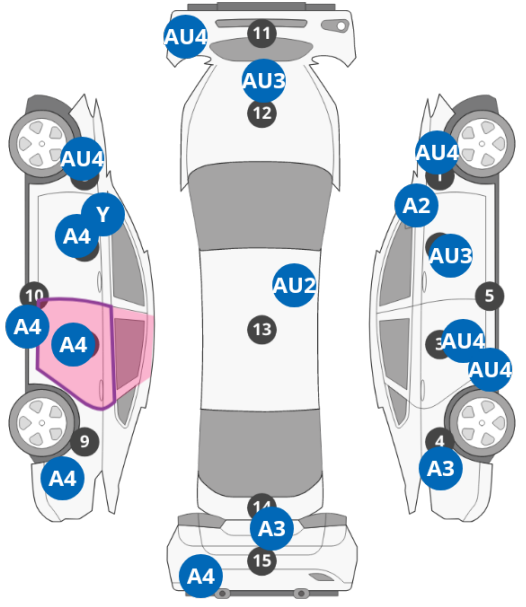
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	144.0	142	157	133
2	Boot Lid	94.3	91	95	98
3	Roof	87.5	97	84	81/88
4	Left Front Fender	92.9	95	93	91
5	Left Front Door	102.5	103	109	96
6	Center Panel Left				
7	Left Rear Door	168.6	172	168	166
8	Left Back Panel	103.8	110	106	96
9	Right Front Fender	90.7	96	92	85
10	Right Front Door	93.9	89	93	100
11	Center Panel Right				
12	Right Rear Door	94.8	88	98	99
13	Right Back Panel	96.0	95	87	106

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks (R) Front Seat - Grime - Medium / (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / (R) Front Trim - Grime - Medium / Rear Seat - Grime - Medium / Trunk Room - Worn, Scratch, Cut, Crack - Small / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Medium / Dashboard - Worn, Scratch, Cut, Crack - Minimal / Room Mirror - Missing - Yes / Ceiling - Grime - Minimal	Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Door, Molding - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch - Large / Trunk Hood, Rear Gate - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Large / (L) Rear Door, Molding - Scratch - Large / (L) Step, In-panel, Side Spoiler - Scratch - Large / (L) Front Door, Molding - Scratch - Large / (L) Mirror - Crack - Damaged / (L) Front Fender, Molding - Scratch & Dent - Large / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch & Dent - Medium / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch - Medium / Roof - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch & Dent - Large
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Turn Signal, Hazard Flasher - Issue - Yes / Head Light, High Beam - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate/No spare tire/No spare key/rear view mirror missing/left side tail light issue/hazard issue/headlight issue/left side mirror damage/engine under cover missing/plate light issue/dome light issue/left side front door issue/No jack and tools/No warranty booklet/glove box issue/No reverse camera/No seat cover/possible flooding/rear seat issue/engine noise/vibration/front and back floor mats missing/