

General Information

Date & Time: 23, Jan, 2026 11:34

Make	Hyundai	Model	Accent
YOM	2018	Odo Meter Reading	91,675
Registration No.	NCM5113	Chassis No.	KMHCT41BHU334476
CC	1.4	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



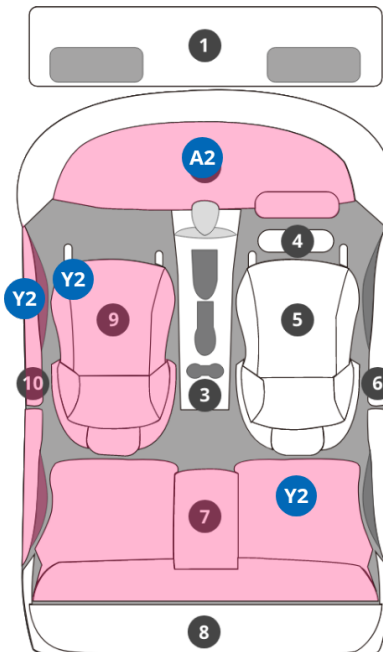
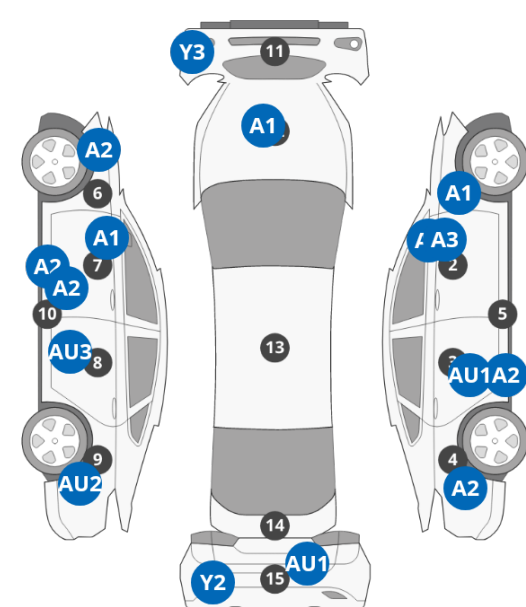
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	131.6	122	137	136
2	Boot Lid	151.3	153	137	164
3	Roof	106.7	129	114	89/95
4	Left Front Fender	263.0	183	442	164
5	Left Front Door	106.5	95	112	113
6	Center Panel Left				
7	Left Rear Door	123.6	118	129	124
8	Left Back Panel	341.6	714	163	148
9	Right Front Fender	169.6	178	156	175
10	Right Front Door	134.3	136	130	137
11	Center Panel Right				
12	Right Rear Door	116.0	144	103	101
13	Right Back Panel	158.3	144	140	191

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Steering Wheel - Worn, Peel, Crack - Small / Rear Seat - Grime - Small / (L) Front Seat - Grime - Small / (L) Front Trim - Grime - Small</p>	<p>Remarks (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Minimal / Overall Exterior - Full Re-Paint in same color - Yes / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Crack, Gap - Small / Trunk Hood, Rear Gate - Scratch & Dent - Minimal / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Crack, Gap - Medium / Bonnet, Headlight - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : D
<p>Remarks Defects not found</p>	<p>Remarks Power Window (each) - Stuck, Gap - Yes / Air Conditioner - Function - Weak / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>With Lto plate, with spare tire,,1key, no warranty booklet, no jack and tools, faded headlights and Antena,cover under hood missing, cover under trunk missing,aircon issue ,stain on roof</p>