

## General Information

Date & Time: 26, Jan, 2026 15:53

<b>Make</b>	Mitsubishi	<b>Model</b>	Xpander
<b>YOM</b>	2019	<b>Odo Meter Reading</b>	75,782
<b>Registration No.</b>	NFT2993	<b>Chassis No.</b>	MK2XRNC1WKN042930
<b>CC</b>	1.5	<b>Transmission</b>	A/T
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	MPV
<b>Colour</b>	Gray		

## Body / Panel Condition



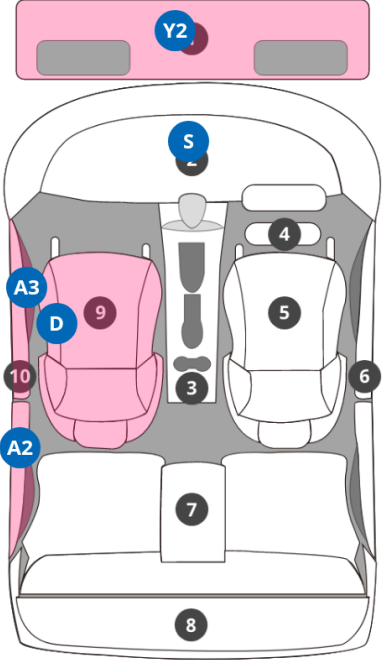
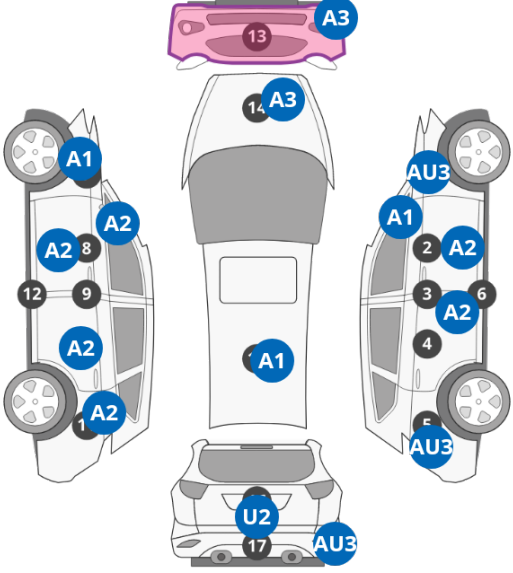
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	99.8	105	91	104
2	Boot Lid	189.6	207	190	172
3	Roof	151.2	138	187	152/128
4	Left Front Fender	86.5	84	90	86
5	Left Front Door	174.6	167	128	229
6	Center Panel Left				
7	Left Rear Door	208.6	229	195	202
8	Left Back Panel	107.6	107	111	105
9	Right Front Fender	83.6	82	87	82
10	Right Front Door	99.1	100	98	100
11	Center Panel Right				
12	Right Rear Door	94.2	98	93	93
13	Right Back Panel	99.3	100	95	103

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Overall Interior - Worn as per age - Yes / (L) Front Trim - Cut, Crack - Medium / (L) Rear Trim - Cut, Crack - Small / (L) Front Seat - Worn - Yes / Ceiling - Grime - Small / Overall Interior - Smell - Yes</p>	<p><b>Remarks</b> (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Scratch &amp; Dent - Medium / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch &amp; Dent - Medium / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Medium / Trunk Hood, Rear Gate - Dent - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Medium / Roof - Scratch - Minimal</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Battery - Weak - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>with warranty booklet, jack and tools, with spare tire, with LTO plate, scratches on tail light, suncrack taillight, fog lamps issue</p>