

## General Information

Date & Time: 26, Jan, 2026 15:57

<b>Make</b>	Mitsubishi	<b>Model</b>	Mirage
<b>YOM</b>	2023	<b>Odo Meter Reading</b>	40,523
<b>Registration No.</b>	EAF4979	<b>Chassis No.</b>	PAEA13TJPNA002964
<b>CC</b>	1.2	<b>Transmission</b>	A/T
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Red		

## Body / Panel Condition



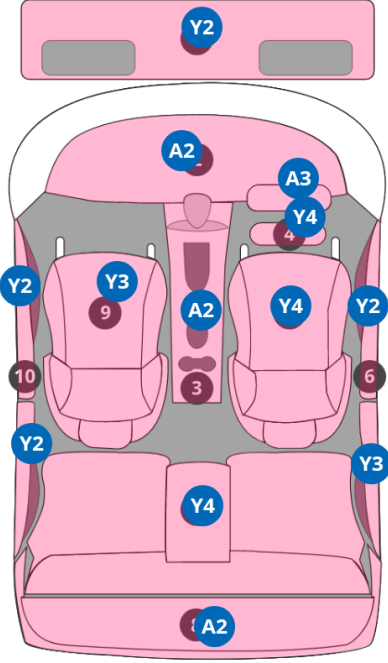
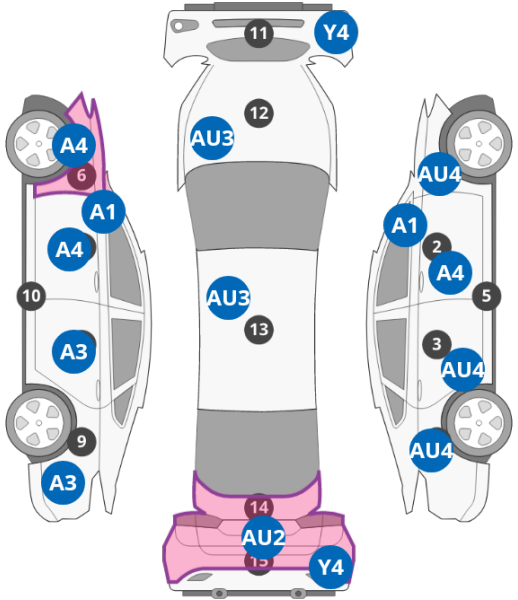
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	102.5	111	97	100
2	Boot Lid	104.6	100	109	105
3	Roof	91.1	95	92	87/91
4	Left Front Fender	168.3	122	181	202
5	Left Front Door	147.6	160	134	149
6	Center Panel Left				
7	Left Rear Door	83.3	84	80	86
8	Left Back Panel	88.5	90	87	89
9	Right Front Fender	101.5	93	112	100
10	Right Front Door	108.0	111	106	107
11	Center Panel Right				
12	Right Rear Door	101.8	98	101	107
13	Right Back Panel	101.5	100	98	107

## Overall Evaluation :

**E**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>E</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>E</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (R) Front Seat - Grime - Large / (R) Front Trim - Grime - Small / Rear Seat - Grime - Large / (R) Rear Trim - Grime - Medium / Trunk Room - Worn, Scratch, Cut, Crack - Small / (L) Rear Trim - Grime - Small / (L) Front Trim - Grime - Small / (L) Front Seat - Grime - Medium / (L) Front Floor Mat - Grime - Large / Steering Wheel - Worn, Peel, Crack - Medium / Ceiling - Grime - Small / Dashboard - Worn, Scratch, Cut, Crack - Small / Console, Switchs, Vents - Worn, Scratch, Cut, Crack - Small</p>	<p><b>Remarks</b> (L) Front Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Large / Bonnet, Headlight - Scratch &amp; Dent - Medium / Front Bumper, Grille, Lamps - Crack, Gap - Large / (R) Front Fender, Molding - Scratch &amp; Dent - Large / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Large / (R) Rear Door, Molding - Scratch &amp; Dent - Large / (R) Rear Fender, Molding - Scratch &amp; Dent - Large / Rear Bumper, Lamps, Panels - Crack, Gap - Large / Trunk Hood, Rear Gate - Scratch &amp; Dent - Small / (L) Rear Fender, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Large / Roof - Scratch &amp; Dent - Medium / (L) Front Fender, Molding - Repair mark - Yes / Trunk Hood, Rear Gate - Repair mark - Yes</p>
<b>Frame Evaluation :</b> <span style="float: right;"><b>B</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>D</b></span>
<p><b>Remarks</b> Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p><b>Remarks</b> Shift Shock - Function - Weak / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Brake Pedal - Function - Weak / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>with LTO plate/with spare tire/No spare key/No reverse camera/No jack and tools/No fog light/brake issue/crossing member support traces of bending/possible flooding/No warranty booklet/No seat cover/rear seat issue/interior dirty/shift shock issue/front and rear bumper issue/trunk room issue</p>