

## General Information

Date & Time: 03, Feb, 2026 19:02

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2024	<b>Odo Meter Reading</b>	18,193
<b>Registration No.</b>	DBM5915	<b>Chassis No.</b>	PA1B18F34R4243228
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Black		

## Body / Panel Condition



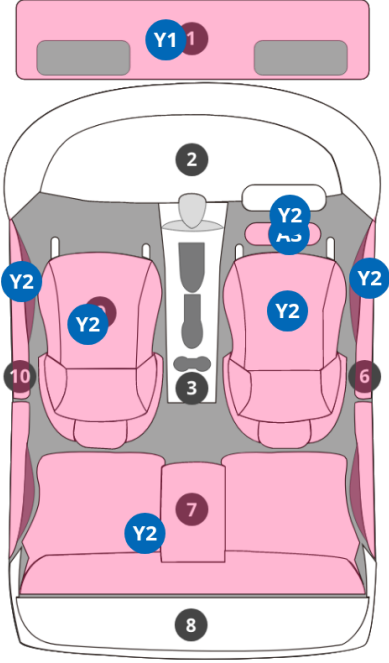
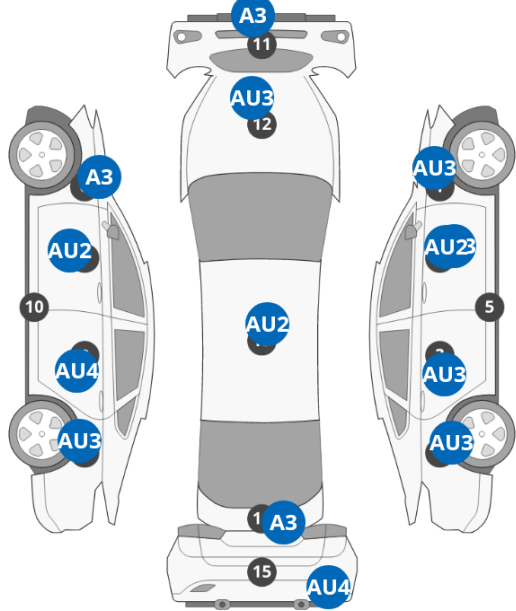
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	108.5	121	100	105
2	Boot Lid	108.1	110	96	118
3	Roof	98.8	100	98	93/105
4	Left Front Fender	104.5	100	104	110
5	Left Front Door	99.8	99	100	101
6	Center Panel Left				
7	Left Rear Door	123.6	163	108	100
8	Left Back Panel	110.0	118	108	104
9	Right Front Fender	104.3	107	103	103
10	Right Front Door	106.5	118	100	102
11	Center Panel Right				
12	Right Rear Door	109.3	104	102	122
13	Right Back Panel	112.6	111	109	118

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b>	B	<b>Exterior Evaluation :</b>	E
			
<p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>		<p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>	
<p><b>Remarks</b> (L) Front Floor Mat - Cut, Crack - Medium / (R) Front Floor Mat - Grime - Small / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / Rear Seat - Grime - Small / Ceiling - Grime - Minimal</p>		<p><b>Remarks</b> (R) Front Fender - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch &amp; Dent - Medium / (L) Front Fender, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch &amp; Dent - Small / (L) Rear Door, Molding - Scratch &amp; Dent - Large / (L) Rear Fender, Molding - Scratch &amp; Dent - Medium / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Large / (R) Rear Fender, Molding - Scratch &amp; Dent - Medium / (R) Rear Door, Molding - Scratch &amp; Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Medium / (R) Front Fender, Molding - Scratch &amp; Dent - Medium / (R) Front Door, Molding - Scratch &amp; Dent - Small / Roof - Scratch &amp; Dent - Small / Trunk Hood, Rear Gate - Scratch - Medium</p>	
<b>Frame Evaluation :</b>	A	<b>Functional Evaluation :</b>	B
<p><b>Remarks</b> Defects not found</p>		<p><b>Remarks</b> Battery - Weak - Yes / Reverse Camera - N/A - Yes / Horn - Issue - Yes / Spare Key - Issue - Unexist</p>	

<b>Inspector Notes</b>
with LTO plate, with spare tire, no warranty and manual booklet, no tools and jack, no reverse camera, scratches on taillight and headlight, no spare key.