

General Information

Date & Time: 27, Jan, 2026 14:58

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	48,899
Registration No.	DBO9103	Chassis No.	PA1B18F39R4258385
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



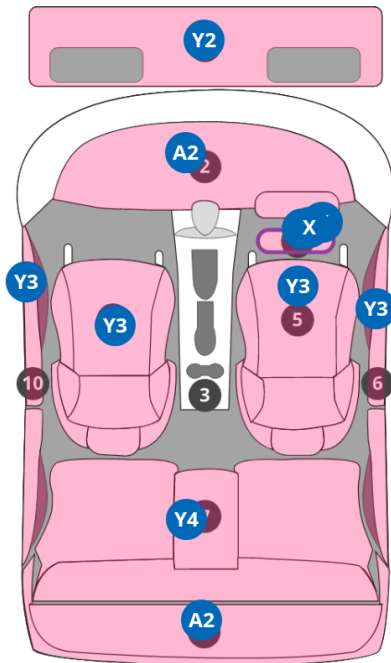
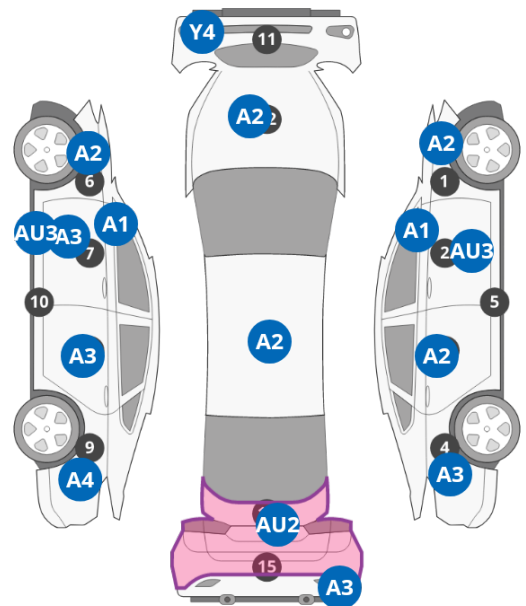
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	100.6	105	95	102
2	Boot Lid	96.6	96	96	98
3	Roof	148.0	158	148	133/153
4	Left Front Fender	135.6	128	136	143
5	Left Front Door	144.0	142	141	149
6	Center Panel Left				
7	Left Rear Door	151.6	166	150	139
8	Left Back Panel	158.0	177	153	144
9	Right Front Fender	143.3	154	137	139
10	Right Front Door	94.4	93	100	91
11	Center Panel Right				
12	Right Rear Door	140.3	133	139	149
13	Right Back Panel	143.0	133	144	152

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks (R) Front Seat - Grime - Medium / (R) Front Trim - Grime - Medium / Rear Seat - Grime - Large / Trunk Room - Worn, Scratch, Cut, Crack - Small / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Medium / (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / Ceiling - Grime - Small / Dashboard - Worn, Scratch, Cut, Crack - Small	Remarks Trunk Hood, Rear Gate - Repair Traces - Yes / Front Bumper, Grille, Lamps - Crack, Gap - Large / Trunk Hood, Rear Gate - Repair mark - Yes / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Large / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Small / Roof - Scratch - Small / Bonnet, Headlight - Scratch - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate/with spare tire/No spare key/with jack and incomplete tools/with reverse camera/front and back floor mats missing/No seat cover/No warranty booklet/possible flooding/trunk hood traces of repair