

## General Information

Date & Time: 27, Jan, 2026 12:18

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2024	<b>Odo Meter Reading</b>	21,842
<b>Registration No.</b>	NFR9697	<b>Chassis No.</b>	PA1B18F39R4242088
<b>CC</b>	1.3	<b>Transmission</b>	M/T
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	White		

## Body / Panel Condition



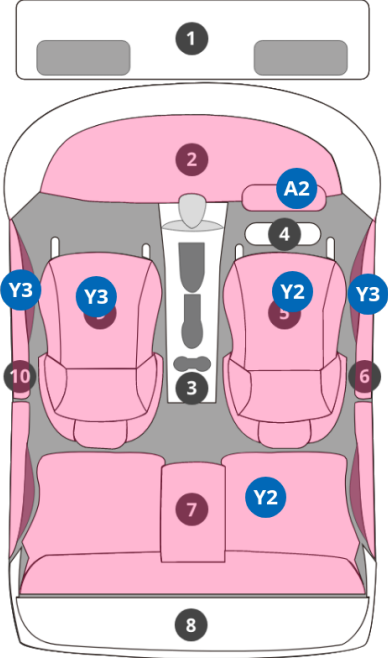
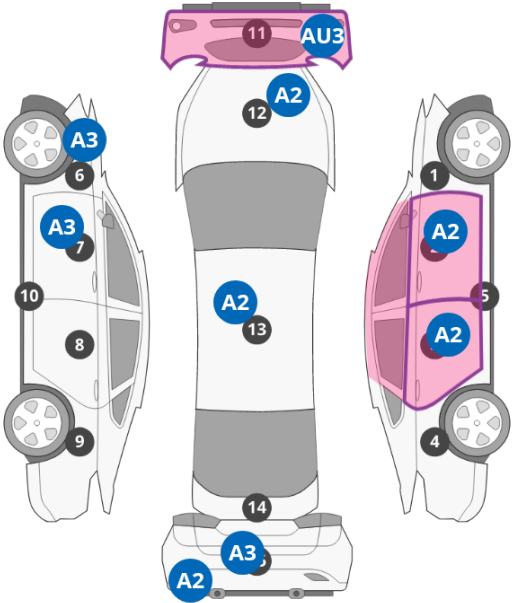
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	125.6	136	104	137
2	Boot Lid	113.3	116	111	113
3	Roof	94.8	98	90	90/101
4	Left Front Fender	95.9	95	92	101
5	Left Front Door	96.5	100	96	94
6	Center Panel Left				
7	Left Rear Door	96.5	101	96	93
8	Left Back Panel	99.8	106	92	102
9	Right Front Fender	105.6	108	106	103
10	Right Front Door	199.0	229	196	172
11	Center Panel Right				
12	Right Rear Door	130.4	97	115	179
13	Right Back Panel	102.1	100	98	109

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>B</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>D</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (R) Front Seat - Grime - Small / (R) Front Trim - Grime - Medium / Rear Seat - Grime - Small / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Medium / Steering Wheel - Worn, Peel, Crack - Small</p>	<p><b>Remarks</b> (R) Front Door - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (R) Front Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Repair mark - Yes / Roof - Scratch - Small / (L) Front Door, Molding - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Small / (L) Front Fender, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch &amp; Dent - Medium / Front Bumper, Grille, Lamps - Repair mark - Yes</p>
<b>Frame Evaluation :</b> <span style="float: right;"><b>A</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>B</b></span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>with LTO plate/with spare tire/No spare key/No reverse camera/with jack and incomplete tools/with warranty booklet/Front seat No seat cover/right side front and rear door repainted</p>