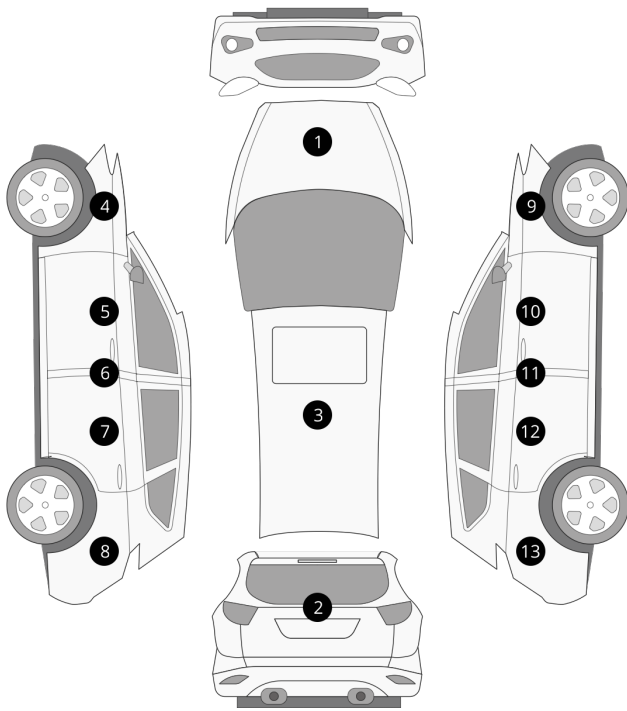


## General Information

Date & Time: 26, Jan, 2026 16:14

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2024	<b>Odo Meter Reading</b>	55,471
<b>Registration No.</b>	NHM6795	<b>Chassis No.</b>	PA1B18F3XR4240172
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Red		

## Body / Panel Condition



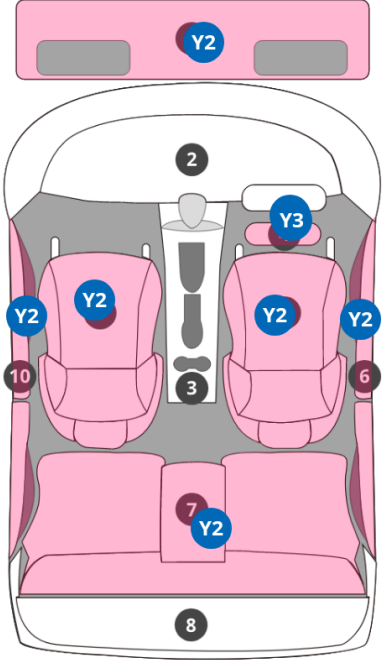
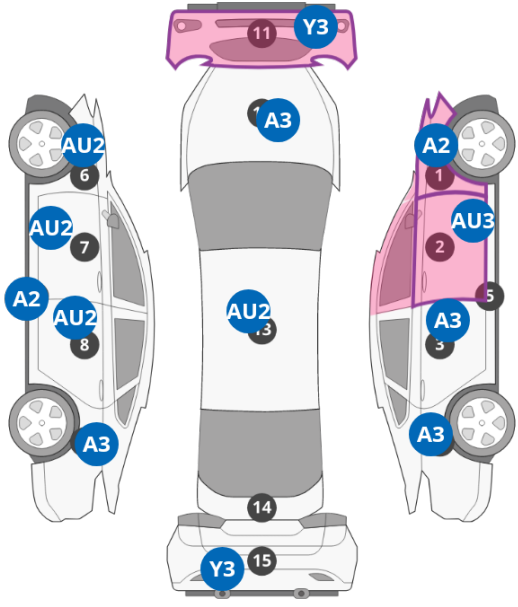
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	117.6	137	106	110
2	Boot Lid	125.6	145	100	132
3	Roof	125.5	125	142	116/119
4	Left Front Fender	113.0	116	103	120
5	Left Front Door	107.3	113	106	103
6	Center Panel Left				
7	Left Rear Door	111.0	113	113	107
8	Left Back Panel	116.0	125	115	108
9	Right Front Fender	322.0	189	362	415
10	Right Front Door	125.3	117	111	148
11	Center Panel Right				
12	Right Rear Door	118.0	112	117	125
13	Right Back Panel	156.6	201	143	126

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>C</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>E</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (L) Front Floor Mat - Cut, Crack - Medium / (R) Front Floor Mat - Grime - Medium / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / Rear Seat - Grime - Small / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small / Ceiling - Grime - Small</p>	<p><b>Remarks</b> (R) Front Fender - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (L) Front Door, Molding - Scratch &amp; Dent - Small / (L) Rear Door, Molding - Scratch &amp; Dent - Small / Roof - Scratch &amp; Dent - Small / (L) Front Fender, Molding - Scratch &amp; Dent - Small / Bonnet, Headlight - Scratch - Medium / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Crack, Gap - Medium / (R) Front Fender, Molding - Repair mark - Yes / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch &amp; Dent - Medium / (R) Front Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Crack, Gap - Medium / (L) Rear Fender, Molding - Scratch - Medium / Trunk Hood, Rear Gate - Scratch &amp; Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small</p>
<b>Frame Evaluation :</b> <span style="float: right;"><b>A</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>B</b></span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Battery - Weak - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>with LTO plate, with spare tire, with jack &amp; incomplete tools, no warranty and manual booklet, with reverse camera, scratches on taillight and headlight.</p>