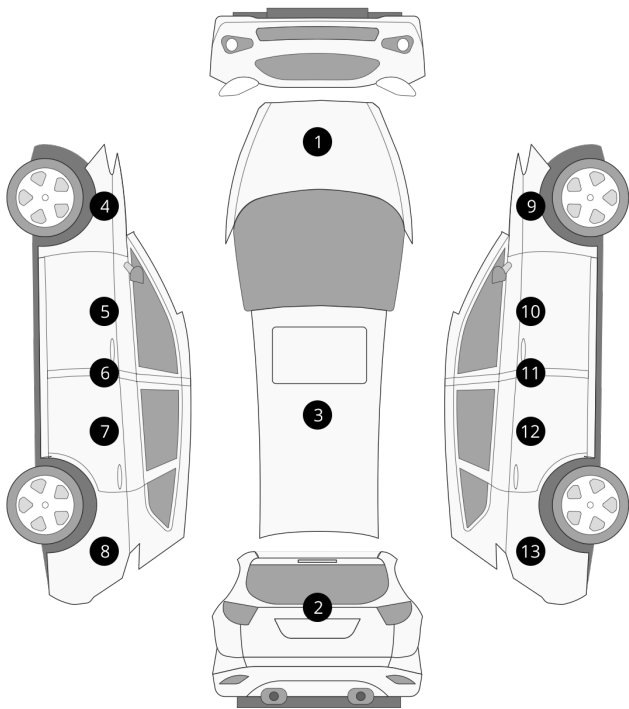


## General Information

Date & Time: 10, Feb, 2026 08:36

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2025	<b>Odo Meter Reading</b>	25,948
<b>Registration No.</b>	DBP9516	<b>Chassis No.</b>	PA1B18F35R4266386
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Silver		

## Body / Panel Condition



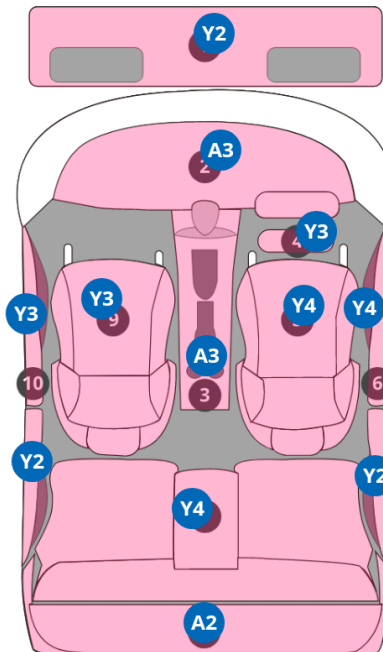
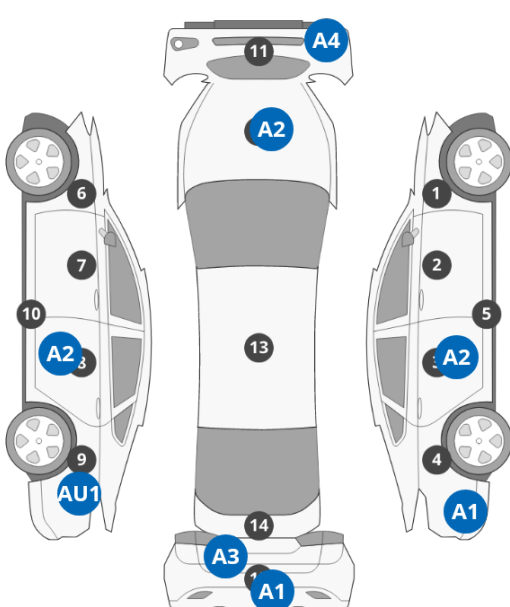
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	104.7	117	95	102
2	Boot Lid	100.0	95	99	106
3	Roof	88.6	99	85	87/83
4	Left Front Fender	90.8	87	91	95
5	Left Front Door	100.3	99	102	100
6	Center Panel Left				
7	Left Rear Door	101.7	108	98	99
8	Left Back Panel	101.4	110	98	96
9	Right Front Fender	95.6	96	94	97
10	Right Front Door	90.1	89	91	90
11	Center Panel Right				
12	Right Rear Door	93.8	93	94	94
13	Right Back Panel	91.0	87	92	95

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>E</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>C</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<b>Remarks</b> (R) Front Seat - Grime - Large / Dashboard - Worn, Scratch, Cut, Crack - Medium / (R) Front Trim - Grime - Large / Rear Seat - Grime - Large / (R) Rear Trim - Grime - Small / Trunk Room - Worn, Scratch, Cut, Crack - Small / (L) Rear Trim - Grime - Small / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Medium / (L) Front Floor Mat - Grime - Medium / Ceiling - Grime - Small / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Medium	<b>Remarks</b> Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Minimal / (L) Rear Fender, Molding - Scratch & Dent - Minimal / (L) Rear Door, Molding - Scratch - Small
<b>Frame Evaluation :</b> <span style="float: right;"><b>A</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>B</b></span>
<b>Remarks</b> Defects not found	<b>Remarks</b> Battery - Weak - Yes

<b>Inspector Notes</b>
with LTO plate/with spare tire/With 3 key/No seat cover/No warranty booklet/with jack and incomplete tools/with reverse camera