

## General Information

Date & Time: 06, Feb, 2026 15:38

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2025	<b>Odo Meter Reading</b>	23,082
<b>Registration No.</b>	DBP7445	<b>Chassis No.</b>	PA1B18F36R4265389
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Black		

## Body / Panel Condition



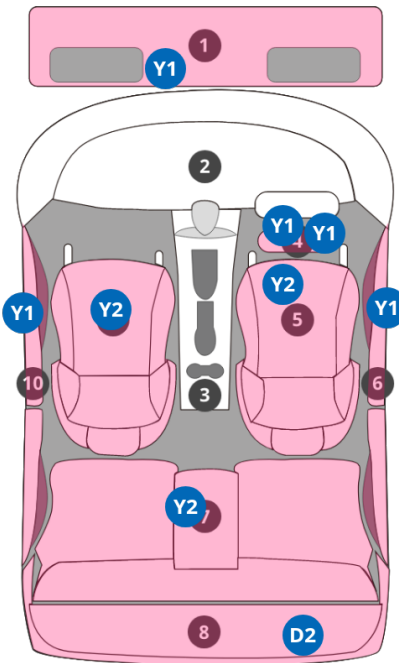
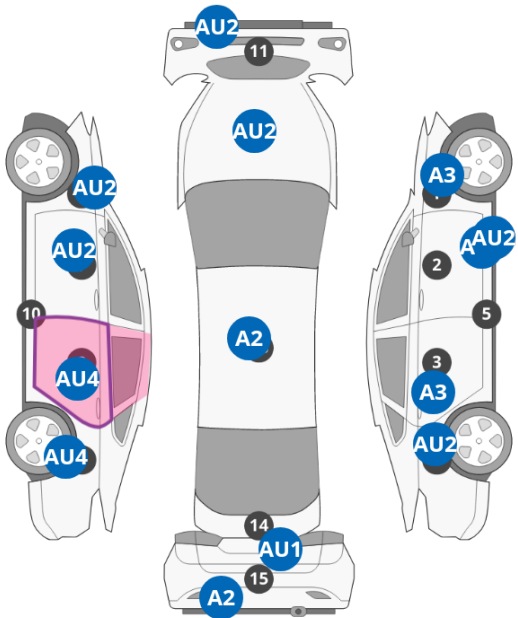
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	106.0	107	99	112
2	Boot Lid	111.3	106	104	124
3	Roof	107.2	112	109	101/107
4	Left Front Fender	99.9	94	103	103
5	Left Front Door	103.3	102	107	101
6	Center Panel Left				
7	Left Rear Door	103.1	105	98	106
8	Left Back Panel	114.3	127	114	102
9	Right Front Fender	109.0	110	106	111
10	Right Front Door	109.6	106	109	114
11	Center Panel Right				
12	Right Rear Door	107.3	106	104	112
13	Right Back Panel	111.6	101	107	127

## Overall Evaluation :

**D**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>B</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>E</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / (L) Front Trim - Grime - Minimal / (R) Front Trim - Grime - Minimal / Rear Seat - Grime - Small / Ceiling - Grime - Minimal / (L) Front Floor Mat - Grime - Minimal / (R) Front Floor Mat - Grime - Minimal / Trunk Room - Loose, Deformed - Small</p>	<p><b>Remarks</b> (L) Rear Door - Repair Traces - Yes / (L) Front Door, Molding - Scratch &amp; Dent - Small / (L) Rear Door, Molding - Partially Missing - Yes / (L) Rear Door, Molding - Scratch &amp; Dent - Large / (L) Rear Fender, Molding - Scratch &amp; Dent - Large / Trunk Hood, Rear Gate - Scratch &amp; Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Rear Fender, Molding - Scratch &amp; Dent - Small / (R) Rear Door, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch &amp; Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Small / (R) Front Fender, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch &amp; Dent - Small / (L) Front Fender, Molding - Scratch &amp; Dent - Small / Bonnet, Headlight - Scratch &amp; Dent - Small / Roof - Scratch - Small</p>
<b>Frame Evaluation :</b> <span style="float: right;"><b>D</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>A</b></span>
<p><b>Remarks</b> Left Center Pillar - Condition of Welding ? - Yes</p>	<p><b>Remarks</b> Defects not found</p>

<p><b>Inspector Notes</b></p>
<p>with LTO plate, with spare tire, with incomplete tools and jack, with reverse camera, with spare key, issue on door handle left rear side, scratches on taillight and headlight, with warranty and manual booklet,.</p>