

General Information

Date & Time: 03, Feb, 2026 06:04

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	55,543
Registration No.	DBI3066	Chassis No.	PA1B18F33P4217880
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



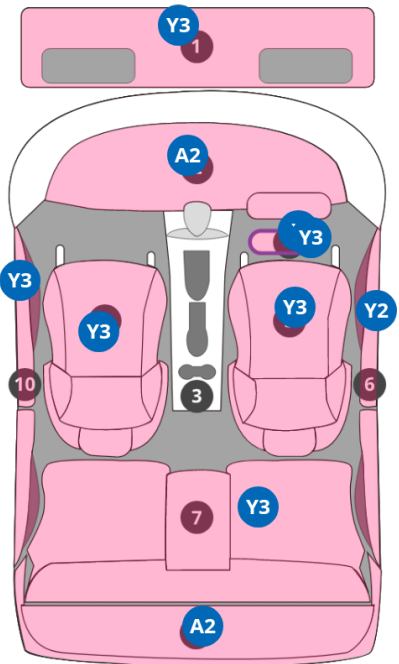
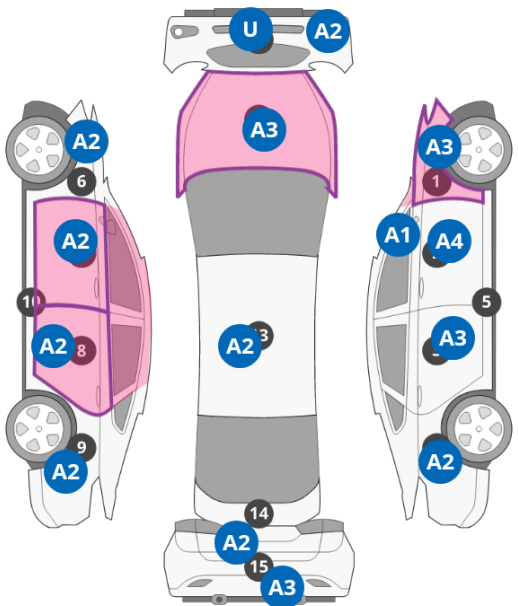
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	293.3	181	445	254
2	Boot Lid	102.2	96	107	104
3	Roof	96.7	100	96	95/96
4	Left Front Fender	107.3	137	98	87
5	Left Front Door	178.0	179	168	187
6	Center Panel Left				
7	Left Rear Door	437.0	602	274	435
8	Left Back Panel	123.3	143	118	109
9	Right Front Fender	613.6	355	734	752
10	Right Front Door	121.3	125	114	125
11	Center Panel Right				
12	Right Rear Door	106.6	100	100	120
13	Right Back Panel	102.2	97	101	109

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Medium / (R) Front Trim - Grime - Small / Rear Seat - Grime - Medium / Trunk Room - Worn, Scratch, Cut, Crack - Small / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Medium / (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Grime - Medium / Ceiling - Grime - Medium / Dashboard - Worn, Scratch, Cut, Crack - Small</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (L) Rear Door, Molding - Repair mark - Yes / (L) Front Door, Molding - Repair mark - Yes / Bonnet, Headlight - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / (L) Front Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch - Small / (R) Front Fender, Molding - Scratch - Medium / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Large / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Roof - Scratch - Small / Member (Bolted) - Dent - Yes</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate/with spare tire/No spare key/reverse camera not working/No jack and tools/with warranty booklet/No seat cover/cheek light issue/right side front seat headrest missing/plate light issue/rear seat issue</p>