

## General Information

Date & Time: 26, Jan, 2026 18:34

<b>Make</b>	Toyota	<b>Model</b>	Hilux
<b>YOM</b>	2024	<b>Odo Meter Reading</b>	34,590
<b>Registration No.</b>	NKA9597	<b>Chassis No.</b>	MR0AB8DD3R5037488
<b>CC</b>	2.4	<b>Transmission</b>	A/T
<b>Fuel Type</b>	Diesel	<b>Type of Body</b>	Pickup
<b>Colour</b>	White		

## Body / Panel Condition



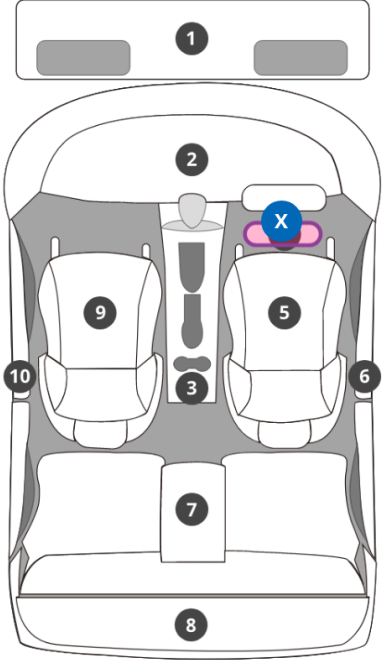
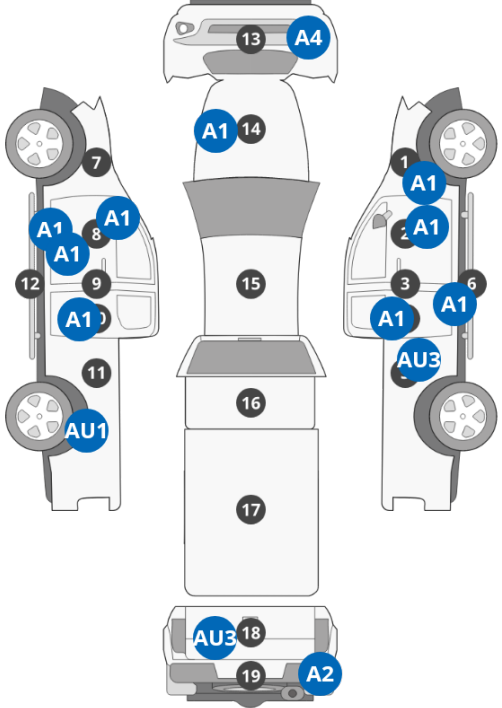
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	106.6	105	112	103
2	Boot Lid	80.0	85	76	79
3	Roof	104.5	96	89	114/119
4	Left Front Fender	94.5	94	95	95
5	Left Front Door	94.3	95	94	94
6	Center Panel Left				
7	Left Rear Door	92.2	92	90	95
8	Left Back Panel	96.5	90	94	105
9	Right Front Fender	92.3	93	94	90
10	Right Front Door	92.9	88	94	97
11	Center Panel Right				
12	Right Rear Door	88.5	85	86	95
13	Right Back Panel	95.9	103	99	86

Overall Evaluation :

**B**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<b>Remarks</b> (L) Front Floor Mat - Missing - Yes	<b>Remarks</b> (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Side Gate - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / Rear Gate - Scratch & Dent - Medium / (L) Side Gate - Scratch & Dent - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch - Minimal
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>
<b>Remarks</b> Defects not found	<b>Remarks</b> Horn - Issue - Yes

<b>Inspector Notes</b>
With Lto plate, with spare tire and tools, 2keys, no warranty booklet and jack, scratches on headlights and taillights, Worn out tires