

General Information

Date & Time: 30, Jan, 2026 13:18

Make	Toyota	Model	Hilux Tamaraw
YOM	2025	Odo Meter Reading	5,863
Registration No.	GBK7251	Chassis No.	PAHACACA8S6422982
CC	2.4	Transmission	M/T
Fuel Type	Diesel	Type of Body	Utility Vehicle
Colour	White		

Body / Panel Condition



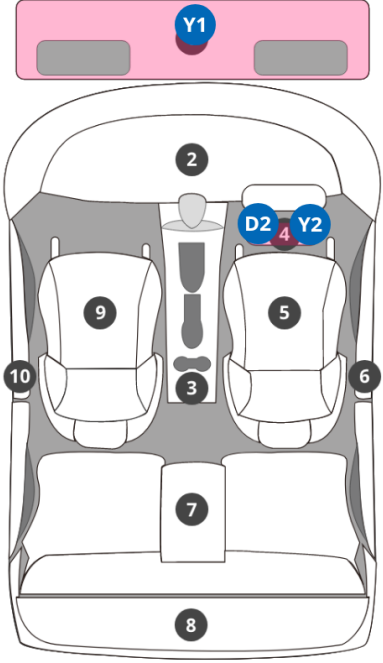
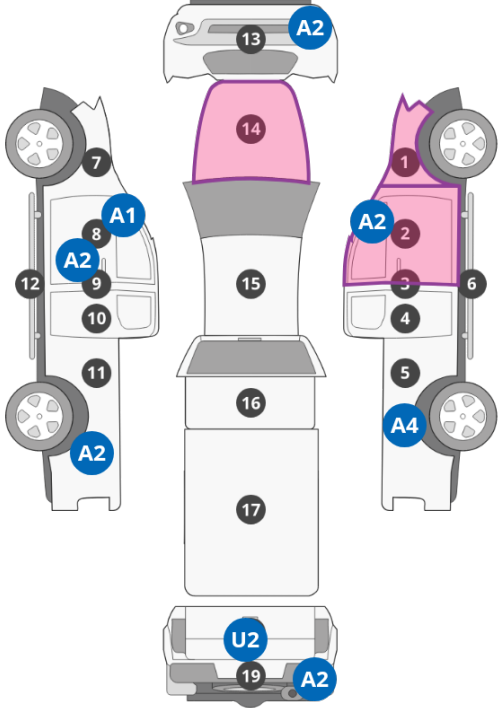
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	153.6	174	178	109
2	Boot Lid	47.4	38	50	54
3	Roof	105.9	102	151	62/109
4	Left Front Fender	105.6	100	97	120
5	Left Front Door	104.3	100	96	117
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	55.4	67	51	48
9	Right Front Fender	157.6	141	144	188
10	Right Front Door	175.3	179	171	176
11	Center Panel Right				
12	Right Rear Door				
13	Right Back Panel	75.8	83	67	78

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Floor Mat - Worked - Small / Ceiling - Grime - Minimal / (R) Front Floor Mat - Grime - Small</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Rear Corner Panel - Repair Traces - Yes / (R) Front Fender, Molding - Repair mark - Yes / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Repair mark - Yes / (R) Side Gate - Scratch - Large / Rear Gate - Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Side Gate - Scratch - Small / (L) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Repair mark - Yes</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>Front right fender repaired With warranty booklet and spare tire. Without jack and tools. 1 key. No LTO plate.</p>