

General Information

Date & Time: 02, Feb, 2026 12:39

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	15,450
Registration No.	GBE1945	Chassis No.	PA1B18F33R4249943
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



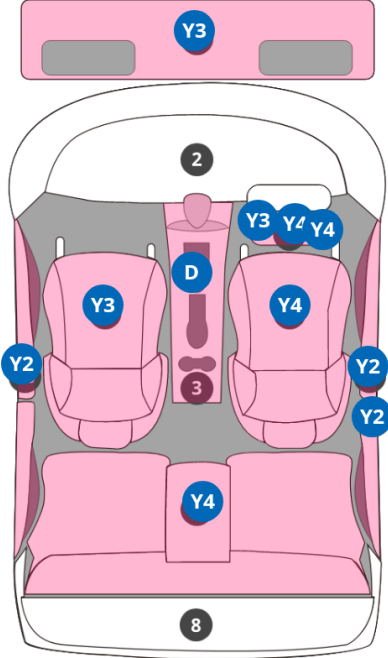
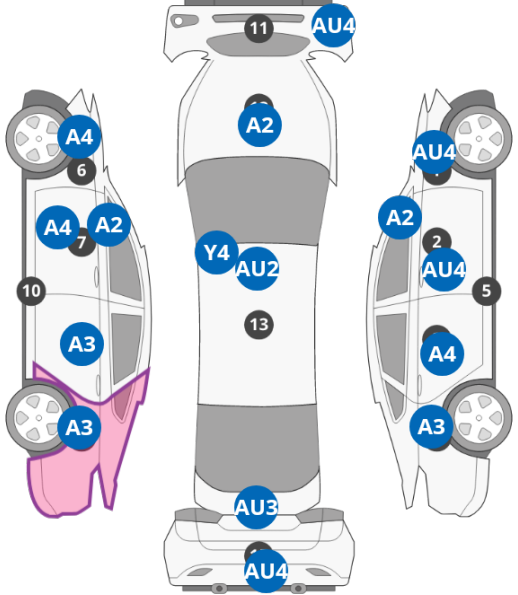
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	116.0	113	113	122
2	Boot Lid	100.8	106	98	98
3	Roof	106.3	116	101	97/111
4	Left Front Fender	119.3	113	115	130
5	Left Front Door	150.3	150	142	159
6	Center Panel Left				
7	Left Rear Door	190.0	207	178	185
8	Left Back Panel	200.0	169	295	136
9	Right Front Fender	125.6	99	131	147
10	Right Front Door	149.3	144	139	165
11	Center Panel Right				
12	Right Rear Door	116.3	109	113	127
13	Right Back Panel	112.3	115	105	117

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : E	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks (L) Front Trim - Grime - Small / (L) Front Floor Mat - Grime - Medium / Ceiling - Grime - Medium / (L) Front Seat - Grime - Medium / Rear Seat - Grime - Large / Mat Other - Grime - Large / (R) Rear Trim - Grime - Small / (R) Front Trim - Grime - Small / (R) Front Seat - Grime - Large / (R) Front Floor Mat - Grime - Large / Console, Switches, Vents - Traces of Adhesive Tape - Yes	Remarks (R) Step - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Front Fender, Molding - Scratch & Dent - Large / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch - Large / (R) Rear Fender, Molding - Scratch - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (L) Rear Fender, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Large / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Large / Bonnet, Headlight - Scratch - Small / Roof - Scratch & Dent - Small / Front Windshield - Damaged - Large / (L) Rear Fender, Molding - Repair mark - Yes
Frame Evaluation : C	Functional Evaluation : A
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes / Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Right Tyre House - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Defects not found

Inspector Notes
Possible flooding. Large crack at front windshield. Trunk floor missing. Right parking sensor missing. With warranty booklet. Without spare tire, jack, tools and seat cover. 3 keys. With LTO plate.