

General Information

Date & Time: 30, Jan, 2026 10:37

Make	Suzuki	Model	Dzire
YOM	2019	Odo Meter Reading	85,421
Registration No.	NBT6853	Chassis No.	MA3ZF63S6KA470680
CC	1.2	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



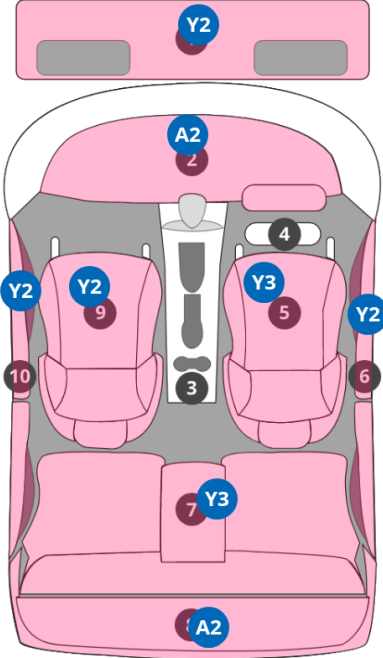
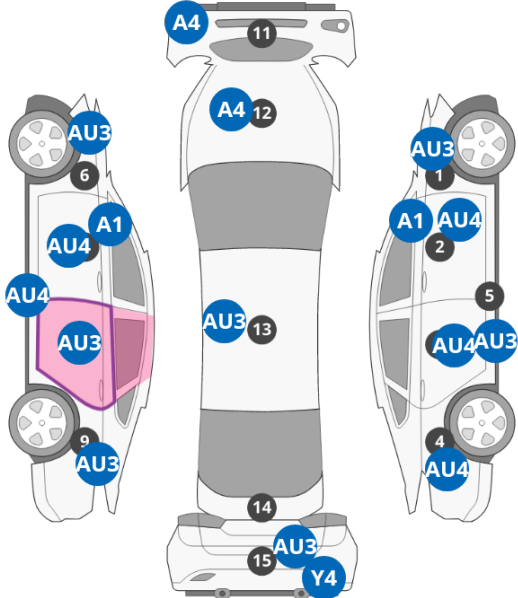
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	80.8	76	82	85
2	Boot Lid	75.5	70	77	79
3	Roof	81.5	76	83	85/81
4	Left Front Fender	142.0	154	143	129
5	Left Front Door	129.6	131	123	135
6	Center Panel Left				
7	Left Rear Door	209.3	225	214	189
8	Left Back Panel	93.6	84	106	91
9	Right Front Fender	95.2	101	95	90
10	Right Front Door	97.8	93	96	104
11	Center Panel Right				
12	Right Rear Door	90.4	91	90	91
13	Right Back Panel	93.7	96	95	91

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Medium / (R) Front Trim - Grime - Small / Rear Seat - Grime - Medium / Trunk Room - Worn, Scratch, Cut, Crack - Small / (L) Front Trim - Grime - Small / (L) Front Seat - Grime - Small / Ceiling - Grime - Small / Dashboard - Worn, Scratch, Cut, Crack - Small</p>	<p>Remarks (L) Rear Door - Repair Traces - Yes / (L) Rear Door, Molding - Repair mark - Yes / (L) Front Door, Molding - Scratch & Dent - Large / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Rear Fender, Molding - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Crack, Gap - Large / (R) Rear Fender, Molding - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch & Dent - Large / (R) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Scratch & Dent - Medium / Bonnet, Headlight - Scratch - Large / Front Bumper, Grille, Lamps - Scratch - Large / (L) Front Fender, Molding - Scratch & Dent - Medium / (L) Mirror - Scratch - Minimal / Roof - Scratch & Dent - Medium</p>
Frame Evaluation : A	Functional Evaluation : E
<p>Remarks Defects not found</p>	<p>Remarks Shift Shock - Function - Weak / Air Conditioner - Function - Weak / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Turn Signal, Hazard Flasher - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate/with spare tire/No spare key/No jack and No tools/No reverse camera/with warranty booklet/trunk room floor cover missing/driver side mat missing/front left side door handle broken/trunk hood issue/front left side fender faded color/with seat cover/front right side rain visor missing/steering wheel issue/trunk hood issue/left side tail light cover crack/fog light issue/shift shock</p>