

## General Information

Date & Time: 04, Feb, 2026 05:06

<b>Make</b>	Toyota	<b>Model</b>	Raize
<b>YOM</b>	2024	<b>Odo Meter Reading</b>	31,704
<b>Registration No.</b>	DBP2595	<b>Chassis No.</b>	MHKAB1BA9RJ090952
<b>CC</b>	1.2	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	SUV
<b>Colour</b>	Gray		

## Body / Panel Condition



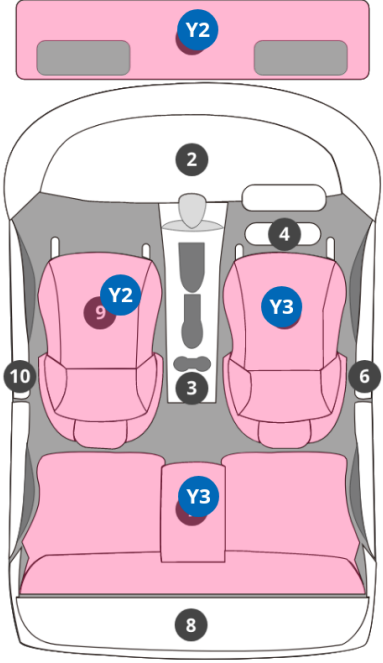
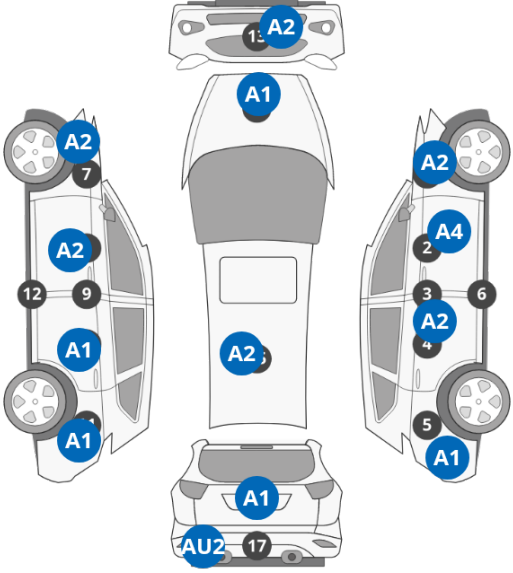
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	84.6	84	92	78
2	Boot Lid	72.2	68	81	68
3	Roof	90.7	88	91	88/96
4	Left Front Fender	91.5	81	99	95
5	Left Front Door	97.2	99	103	90
6	Center Panel Left				
7	Left Rear Door	91.3	99	93	82
8	Left Back Panel	77.2	72	75	85
9	Right Front Fender	88.6	95	95	76
10	Right Front Door	91.6	89	93	94
11	Center Panel Right				
12	Right Rear Door	93.0	96	92	92
13	Right Back Panel	79.1	88	73	76

Overall Evaluation :

**B**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (R) Front Seat - Grime - Medium / Rear Seat - Grime - Medium / (L) Front Seat - Grime - Small / Ceiling - Grime - Small</p>	<p><b>Remarks</b> (L) Rear Door, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Large / (R) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / Roof - Scratch - Small</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>with LTO plate/with spare tire/No spare key/No seat cover/No reverse camera/unusual sound engine/with jack and incomplete tools/with warranty booklet/</p>