

## General Information

Date & Time: 03, Feb, 2026 06:04

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2025	<b>Odo Meter Reading</b>	3,990
<b>Registration No.</b>	DBU7129	<b>Chassis No.</b>	PA1B18F35S4287132
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Red Mica Metallic		

## Body / Panel Condition



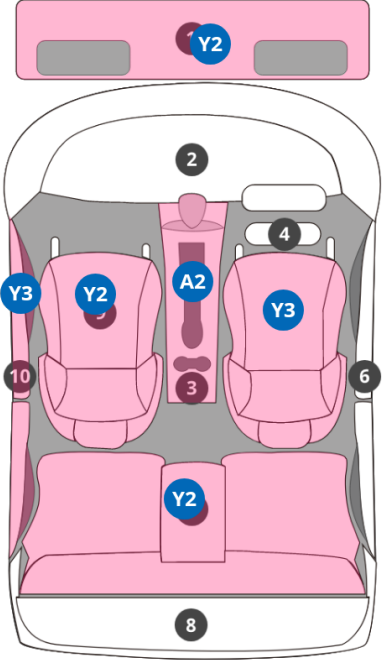
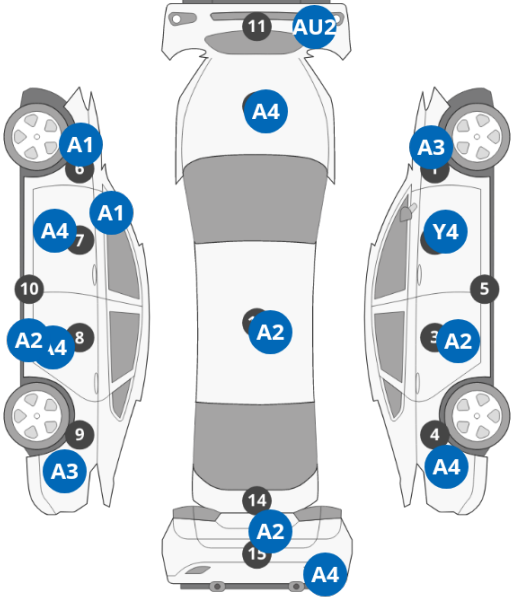
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	99.7	100	95	105
2	Boot Lid	98.1	99	94	102
3	Roof	83.5	88	84	76/86
4	Left Front Fender	90.0	93	85	92
5	Left Front Door	90.1	91	87	92
6	Center Panel Left				
7	Left Rear Door	99.8	112	96	91
8	Left Back Panel	106.5	110	110	100
9	Right Front Fender	90.6	92	90	90
10	Right Front Door	90.0	85	92	94
11	Center Panel Right				
12	Right Rear Door	89.1	85	91	91
13	Right Back Panel	90.6	88	86	98

Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (R) Front Seat - Grime - Medium / Ceiling - Grime - Small / Console, Switchs, Vents - Worn, Scratch, Cut, Crack - Small / (L) Front Seat - Grime - Small / (L) Front Trim - Grime - Medium / Rear Seat - Grime - Small</p>	<p><b>Remarks</b> (L) Front Door, Molding - Scratch - Large / (L) Rear Door, Molding - Scratch - Large / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Rear Fender, Molding - Scratch - Medium / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Large / Front Bumper, Grille, Lamps - Scratch &amp; Dent - Small / (R) Front Fender, Molding - Scratch - Medium / (R) Front Door, Molding - Crack, Gap - Large / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Large / Rear Bumper, Lamps, Panels - Scratch - Large / Trunk Hood, Rear Gate - Scratch - Small / Roof - Scratch - Small</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Battery - Weak - Yes</p>

<p><b>Inspector Notes</b></p>
<p>with LTO plate/with spare tire/with 1 spare key/with jack and incomplete tools/with reverse camera/No seat cover/with warranty booklet/right side front door issue/rear seat issue</p>