

General Information

Date & Time: 05, Feb, 2026 15:45

Make	Suzuki	Model	S-Presso
YOM	2023	Odo Meter Reading	55,589
Registration No.	NIF5769	Chassis No.	MA3FL41S6PA377507
CC	1.0	Transmission	M/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	Gray		

Body / Panel Condition



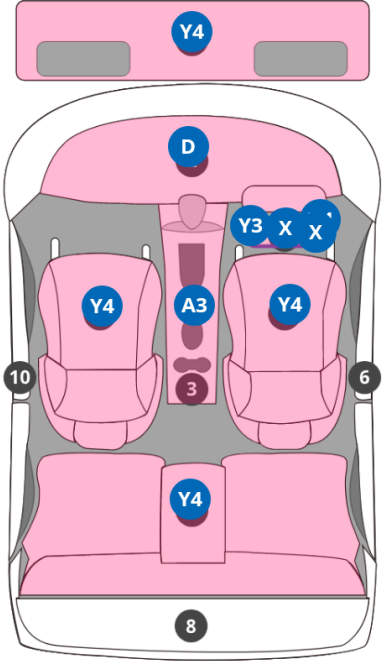
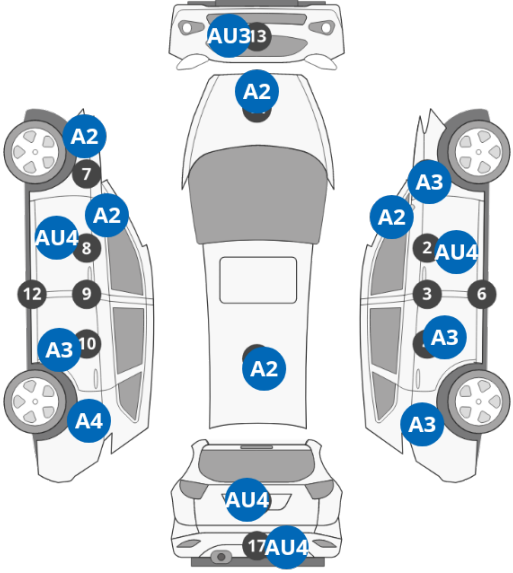
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	102.6	102	102	104
2	Boot Lid	111.6	112	112	111
3	Roof	105.2	108	110	105/98
4	Left Front Fender	102.8	94	116	99
5	Left Front Door	110.3	108	113	110
6	Center Panel Left				
7	Left Rear Door	103.0	108	100	101
8	Left Back Panel	117.6	122	115	116
9	Right Front Fender	94.1	98	93	92
10	Right Front Door	108.0	103	109	112
11	Center Panel Right				
12	Right Rear Door	100.5	99	100	103
13	Right Back Panel	108.6	109	113	104

Overall Evaluation :

E

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : E	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks (L) Front Seat - Grime - Large / (L) Front Floor Mat - Grime - Medium / Ceiling - Grime - Large / Mat Other - Missing - Yes / Rear Seat - Grime - Large / (R) Front Seat - Grime - Large / Carpet - Worked - Large / (R) Front Floor Mat - Missing - Yes / Knobs - Worn, Peel, Crack - Medium / Dashboard - Traces of Adhesive Tape - Yes	Remarks Rear End Panel - Repair Traces - Yes / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Large / (L) Front Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Large / Trunk Hood, Rear Gate - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch & Dent - Large / (R) Mirror - Scratch - Small / (R) Front Fender, Molding - Scratch - Medium / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Roof - Scratch - Small
Frame Evaluation : D	Functional Evaluation : A
Remarks Rear Side Member & Trunk Room Floor - Condition of Welding, Hardness and Shape of Sealant ? - Yes / Right Tyre House - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Tyre House - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
Possible flooding. Trunk door cannot open. Damaged trunk door and rear bumper. Crack left tail light. Without warranty booklet and seat cover. Cannot confirm if with spare tire, jack and tools. 1 key. With LTO plate.