

## General Information

Date & Time: 02, Feb, 2026 10:31

<b>Make</b>	Toyota	<b>Model</b>	Wigo
<b>YOM</b>	2025	<b>Odo Meter Reading</b>	13,174
<b>Registration No.</b>	GBJ5962	<b>Chassis No.</b>	MHKAA1BC0SJ036062
<b>CC</b>	1.0	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Hatchback
<b>Colour</b>	Gray		

## Body / Panel Condition



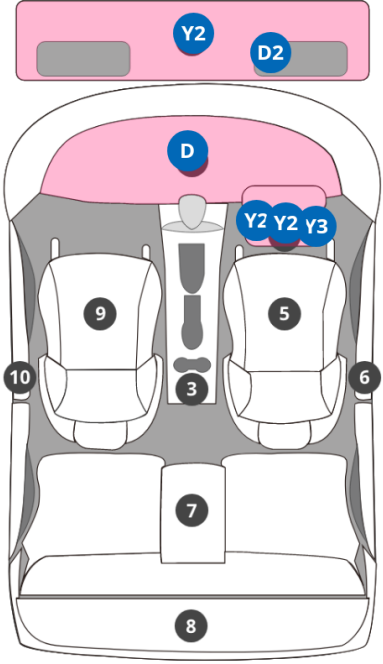
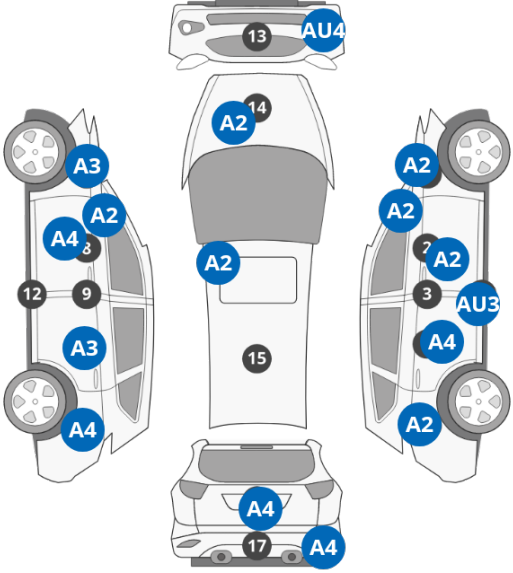
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	119.3	118	123	117
2	Boot Lid	102.8	109	101	99
3	Roof	98.5	101	98	101/95
4	Left Front Fender	104.0	104	104	104
5	Left Front Door	109.3	106	104	118
6	Center Panel Left				
7	Left Rear Door	108.0	120	103	101
8	Left Back Panel	101.0	100	103	100
9	Right Front Fender	99.5	95	100	104
10	Right Front Door	110.0	118	106	106
11	Center Panel Right				
12	Right Rear Door	113.3	113	108	119
13	Right Back Panel	102.3	101	101	105

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (L) Front Floor Mat - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes / Sunvisor, Sunglass Holder - Crinkle - Small / Ceiling - Grime - Small / (R) Front Floor Mat - Grime - Medium / Mat Other - Grime - Small</p>	<p><b>Remarks</b> (L) Front Fender, Molding - Scratch - Medium / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch - Large / (L) Rear Door, Molding - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Large / Trunk Hood, Rear Gate - Scratch - Large / Rear Bumper, Lamps, Panels - Scratch - Large / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Large / (R) Front Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Medium / (R) Mirror - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch &amp; Dent - Large / Roof - Scratch - Small</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Defects not found</p>

<p><b>Inspector Notes</b></p>
<p>Abnormal vibration at engine. Without warranty booklet, jack and tools. With spare tire and seat cover. 2 keys. With LTO plate.</p>